MONITORING, SAMPLING AND ANALYSIS FOR AMBIENT AIR QUALITY, SURFACE WATER QUALITY AND GROUND WATER QUALITY IN CRITICALLY/SEVERELY/OTHER POLLUTED AREAS

DOMBIVALI

Pre-Monsoon (April 2025 - June 2025)







MAHARASHTRA POLLUTION CONTROL BOARD महाराष्ट्र प्रदूषण नियंत्रण मंडळ

Index

1.	ABBREVIATIONS	. 3
1.	Executive Summary	. 4
2.	Introduction	. 5
3.	Scope of Work	. 8
	lle 3.1 Sampling Details of Dombivali	10
5.	Air Environment	13
	ole 5.1 Phase I - Details of Sampling Location of Ambient Air Quality Monitoring	ng
Tab Tab	ole 5.3 Phase I - Results of Ambient Air Quality Monitoring	15 15 21 ng
Tab	ole 5.7 Phase II - Results of Ambient Air Quality Monitoring	23 23
Tab Tab Tab	ble 6.1 Phase I – Details of Sampling Location of Surface Water	31 38 39
Tab Tab Tab	ole 7.1 Phase I – Details of Sampling Location of Groundwater	47 52 53
9.	CEPI Score	59
Tab	lle 8.1 CEPI score of the Pre-monsoon season 2025 is given below	59
11.	Efforts Taken by MPCB to Control and Reduce Environmental Pollution Index	63
12	Photographs	66

ABBREVIATIONS

АРНА	American Public Health Association
ASTM	American Society for Testing and Materials
BIS	Bureau of Indian Standards
BLQ	Below the Limit of Quantification
CAAQMS	Continuous Ambient Air Quality Monitoring Station
CEMS	Continuous Emission Monitoring System
СЕРІ	Comprehensive Environmental Pollution Index
СЕТР	Common Effluent Treatment Plant
СРА	Critically Polluted Area
СРСВ	Central Pollution Control Board
ЕРА	Environmental Protection Act, 1986
GDP	Gross Domestic Product
MIDC	Maharashtra Industrial Development Corporation
МРСВ	Maharashtra Pollution Control Board
NAAQS	National Ambient Air Quality Standard
NWMP	National Water Quality Monitoring Program
SPA	Severely Polluted Area
VOCs	Volatile Organic Compounds
wно	World Health Organisation
ZLD	Zero Liquid Discharge

1. Executive Summary

The Dombivali CEPI area includes MIDC Phase I and MIDC Phase II and was monitored for Ambient Air Quality, Ground and Surface Waters quality and CEPI Score was calculated based on the Latest directions 120 of Letter No. B-29012/ESS (CPA)/2015-16 dated 26th April 2016 of Central Pollution Control Board (CPCB). Maharashtra Pollution Control Board (MPCB) has carried out monitoring at CPCB location with the additional location of samplings for ambient air, surface and Groundwater in consideration with the previous CEPI monitoring and covering the entire CEPI Impact Zone. The pre-monsoon monitoring was carried out during the period of April to June 2025 to verify the Ambient Air Quality, Surface water and Groundwater.

The Ambient Air Quality Monitoring stations were strategically selected considering the upwind and crosswind directions within the CEPI impact area to ensure representative data collection. The concentrations of PM₁₀ and PM_{2.5} are found to be within the permissible limits prescribed by the National Ambient Air Quality Standards (NAAQS), 2009. In surface water samples, elevated concentrations of Total Kjeldhal Nitrogen (TKN) and Biological Oxygen Demand (BOD) were observed at a few locations, exceeding acceptable limits. However, groundwater quality in the study area is found to be within acceptable limits for all monitored parameters.

As per the study conducted by the Central Pollution Control Board (CPCB) in March 2018, the CEPI score for the Dombivali region, calculated under the revised CEPI 2016 methodology, was 69.67 (Ambient Air – 62.00, Surface Water – 63.50, Land – 27.25). The primary contributors to the CEPI score in 2018 were high concentrations of PM₁₀ and PM_{2.5} in ambient air. In contrast, the present study reveals that the concentrations of these particulate matters are now well within the prescribed standards, indicating a significant improvement in air quality.

The Maharashtra Pollution Control Board (MPCB) has implemented a series of pollution control measures and action plans over the years, which have contributed to a notable reduction in pollution levels. These efforts have resulted in a significant drop in the CEPI score—from 69.67 in 2018 to 48.30 in June 2025—reflecting a decrease of approximately 31%.

According to the present assessment conducted during the Pre-Monsoon 2025 period under the revised CEPI guidelines (2016), the sub-scores are as follows: Ambient Air – 31.0, Surface Water – 42.8, and Groundwater – 30.8. The overall CEPI score for the Dombivali region stands at 48.3, highlighting considerable progress in environmental quality across all three components

2. Introduction

As of 2025, the industrial sector remains a cornerstone of national economic progress, driving production, infrastructure development, employment generation, exports, and capacity utilization. Industries play a critical role in strengthening government revenue, advancing international trade, and enhancing social development. Their contribution significantly influences a country's GDP, and by extension, its global economic standing. According to the World GDP Rankings 2024, India is positioned as the fifth-largest economy globally, underscoring the strategic importance of its industrial growth. Sustainable Development Goals (SDGs), particularly Goal 8: Decent Work and Economic Growth and Goal 9: Industry, Innovation, and Infrastructure, emphasize the need for balanced industrial development.

However, the benefits of industrialization come with a heavy environmental cost. In 2025, industrial pollution continues to pose serious threats to air, water, and soil quality. The indiscriminate discharge of untreated industrial effluents contaminates drinking water sources, endangering human health, aquatic ecosystems, and animal life. Air pollution caused by emissions from industries has been directly linked to respiratory and cardiovascular diseases, especially among vulnerable populations such as children and the elderly. According to the World Health Organization (WHO), environmental pollution accounts for nearly 9 million premature deaths annually, with over 90% of the global population breathing air that exceeds safe pollution limits. Additionally, approximately 2 billion people still rely on drinking water sources contaminated with faecal matter, contributing to widespread outbreaks of waterborne diseases like cholera and dysentery.

The ecological impacts are equally alarming. Industrial pollution has led to the destruction of habitats, a decline in biodiversity, and the disruption of delicate ecosystems. Toxic substances can cause reproductive anomalies, genetic mutations, and behavioural changes in wildlife, threatening species survival. Vegetation exposed to pollutants suffers from reduced photosynthesis, stunted growth, and increased vulnerability to pests and diseases—factors that ultimately undermine food security and ecological stability.

To combat these challenges, robust environmental governance is more critical than ever. Effective policy frameworks must regulate industrial operations through continuous pollution monitoring, stringent enforcement, and comprehensive environmental impact assessments (EIAs). Conservation strategies aimed at preserving biodiversity must be regularly updated to reflect evolving threats. A sustainable industrial future requires coordinated efforts between government agencies, industries, and communities, underpinned by advanced technologies and transparent regulatory mechanisms.

Within this framework, the Comprehensive Environmental Pollution Index (CEPI) has emerged as a pivotal tool in India's environmental management strategy. As of 2025, CEPI continues to serve as a standardized system for evaluating pollution levels in industrial clusters across the country. Developed collaboratively by scientists, regulatory authorities, and community stakeholders, CEPI

facilitates the identification of pollution hotspots and the implementation of corrective measures. By integrating air, water, and land pollution parameters, CEPI enables data-driven decision-making for resource allocation and regulatory intervention.

In Maharashtra, a state with thriving industrial zones and increasing urbanization, the role of CEPI is particularly significant. The assessment and monitoring of environmental parameters in heavily industrialized areas like Chembur (Mumbai) and Dombivali MIDC (Phase I & II) help identify the pressing challenges posed by pollution. Established in 1964, the Dombivali industrial cluster has seen rapid growth in chemical, textile, and engineering sectors, resulting in serious environmental concerns from emissions, effluents, and solid waste disposal, particularly given its proximity to residential neighbourhoods.

This report presents a detailed analysis of pollution in these areas, following the revised CEPI methodology (2016). The study includes comprehensive monitoring, sampling, and analysis of ambient air, surface water, and groundwater quality to assess the environmental burden in Dombivali. The index-based framework helps quantify the extent of pollution, identify critical sources and pathways, and guide regulatory actions.

Despite ongoing challenges, CEPI-driven strategies have created a foundation for structured, long-term pollution mitigation. Through regulatory enforcement, stakeholder collaboration, sustainable industrial practices, and urban planning reforms, this report aims to support actionable insights for ecological restoration and a cleaner, healthier future for Maharashtra's industrial regions.



Fig. Dombivali Region CEPI Monitoring Zone

3. Scope of Work

The major scope of work includes:

- I. The scope of the present study is to perform three (3) rounds of "Monitoring, Sampling and Analysis for Ambient Air Quality, VOCs in Ambient Air, Surface Water Quality & Groundwater Quality in selected Pollution Industrial Areas (PIAs) of Dombivali, Maharashtra" with a gap of one or two days. The analysis of the collected samples was carried out by the standard methods (CPCB, BIS, APHA, USEPA).
- II. To Collect health-related data in the CEPI region.
- III. To calculate the Comprehensive Environmental Pollution Index (CEPI) Score as per Revised CEPI-2016 issued by Central Pollution Control Board (CPCB).

The sampling details and frequency of sampling in Ambient Air, VOCs, Surface Water and Groundwater are given in Table 3.1 and Table 3.2 respectively.

Table 3.1 Sampling Details of Dombivali

Sampling Criteria	Number of sites	Total Sites	Monitoring Parameters
Ambient Air Quality	Phase I-04Phase II-04	08	PM ₁₀ , PM _{2.5} , SO ₂ , NO ₂ , NH ₃ , O ₃ , C ₆ H ₆ , CO, BAP, Pb, Ni, As
Volatile Organic Compounds (VOCs)	• Phase I-02 • Phase II-02	04	Dichloromethane, Chloroform, Carbon Tetrachloride, Trichloroethylene, Bromodichloromethane, 1,3-Dichloropropane, 1,4-Dichlorobenzene, 1,2-Dichlorobenzene, 1,2-Dichlorobenzene, 1,2-Dichlorobenzene, 1,2-Dichlorobenzene, 1,2-Dichlorobenzene, 1,2-Dichlorobenzene, 1,2,4-Trimethylbenzene, P-Chlorotoluene, Tert-Butylbenzene, SEC-Butylbenzene, P-Isopropyl toluene, M-Xylene, P-Xylene, Styrene, Cumene 1,2,3-Trichloropropane, N-Propyl benzene, Dibromochloromethane, 1,2-Dibromoethane, Chlorobenzene, 1,1-Dichloropropylene, 1,2-Dichloroethane, 1,1-Dichloropropane, Trans-1,3-Dichloropropene, CIS 1,3-Dichloropropene, 1,1,2-Trichloroethane, Tetrachloroethylene, 1,3,5-Trimethylbenzene, N-Butylbenzene, 1,2,3-Trichlorobenzene, Pexachlorobutadiene, 1,2,4-Trichlorobenzene, 2,2-Dichloropropane, Dibromo methane, Toluene, O-Xylene, Bromoform, 1,1,2,2-Tetrachloroethane, 4-Chlorotoluene, 1,1-Dichloroethylene, Trans-1,2-Dichloroethylene, 1,1-Dichloroethylene, CIS-1,2-Dichloroethylene, Bromochloromethane, 1,1,1-Trichloroethane


Sampling Criteria	Number of sites	Total Sites	Monitoring Parameters
			(i) Simple Parameters Sanitary Survey, General Appearance, Colour, Smell, Transparency and Ecological
			(ii) Regular Monitoring Parameters
Water Quality	• Phase I-06 • Phase II-06	12	pH, O & G, Suspended Solids, DO, COD, BOD, TDS, Electrical Conductivity, Total Dissolved Solids, Nitrite-Nitrogen, Nitrate-Nitrogen, (NO ₂ +NO ₃) total nitrogen, Free Ammonia, Total Residual Chlorine, Cyanide, Fluoride, Chloride, Sulphate, Sulphides, Total Hardness, Dissolved Phosphates, SAR, Total Coliforms, Faecal Coliform
Monitoring			(iii) Special Parameters
	Groundwater • Phase I-03 • Phase II-03	06	Total Phosphorous, TKN, Total Ammonia (NH4+NH3)-Nitrogen, Phenols, Surface Active Agents, Anionic detergents, Organo-Chlorine Pesticides, PAH, PCB and PCT, Zinc, Nickel, Copper, Hexa-valent Chromium, Chromium (Total), Arsenic (Total), Lead, Cadmium, Mercury, Manganese, Iron, Vanadium, Selenium, Boron
			(iv) Bioassay (zebra Fish) Test – For specified samples only.

Table 3.2 Frequency of Sampling

	Parameter	Round of Sampling	Frequency in Each Round	
A	Ambient Air Quality Monitoring			
1.	Particulate Matter (size less than 10 μ m) or PM ₁₀	03	3 Shifts of 8 hrs each	
2.	Particulate Matter (size less than 2.5 µm) or PM _{2.5}	03	1 Shift of 24 hrs	
3.	Sulphur Dioxide (SO ₂)	03	6 Shifts of 4 hrs each	
4.	Nitrogen Dioxide (NO ₂)	03	6 Shifts of 4 hrs each	
5.	Ammonia (NH ₃)	03	6 Shifts of 4 hrs each	
6.	Ozone (O ₃)	03	24 Shifts of 1 hr each	
7.	Benzene (C ₆ H ₆)	03	1 Shifts of 24 hrs	
8.	Carbon Monoxide (CO)	03	24 Shifts of 1 hr each	
9.	Benzo (a) Pyrene (BaP) – particulate phase only	03	3 Shifts of 8 hrs each	
10.	Lead (Pb)	03	3 Shifts of 8 hrs each	
11.	Arsenic (As)	03	3 Shifts of 8 hrs each	
12.	Nickel (Ni)	03	3 Shifts of 8 hrs each	
В	Volatile Organic Compounds (VOCs)			
	As mentioned in Table 3.1	03	3 Shifts of 24 hrs each	
С	Groundwater			
	As mentioned in Table 3.1	03	01 sample at each round	
D	Surface Water			
	As mentioned in Table 3.1	03	01 sample at each round	

4. Methodology

The present report is based on the revised Comprehensive Environmental Pollution Index (CEPI) version 2016. The index captures the various dimensions of the environment including air, water and land. Comprehensive Environmental Pollution Index (CEPI) is a rational number, which is used to characterize the environmental quality at a given location. It is three-step process based on the algorithm of Source, pathway and Receptor.

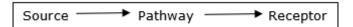

Ambient air stations, Surface water locations and Groundwater locations were decided by the respective regional officers. The sampling was done in 3 rounds with an interval of one or two days at each location. Sampling has been done at the potential polluted areas so as to arrive at the CEPI. This will further help the authorities to monitor the areas in order to improve the current status of their environmental components such as air and water quality data, ecological damage and visual environmental conditions.

Methodology for sampling, preservation and analysis have been done according to the CPCB/ EPA/ APHA/ IS/ ASTM standard methods for the samples.



5. Air Environment

For studying the Air Environment of Dombivali area, monitoring stations were identified considering the upwind and cross wind direction and all 12 parameters as per the notification of National Ambient Air Quality Standards (NAAQS) were determined.

*Kindly note: Volatile Organic Compounds (VOCs) concentration is not detected in most of the Air samples collected; hence it is not shown in the graphs.

1. <u>MIDC Phase I:</u> In MIDC Phase I of Dombivali four locations have been monitored for Ambient Air Quality (AAQ). The AAQ monitoring was carried out by taking samples in triplicate on 07th May to 12th May 2025. All twelve parameters are observed well within the limits at all 4 locations monitored.

Table 5.1 Phase I - Details of Sampling Location of Ambient Air Quality Monitoring

Sr.	Name of		l amaituda	Date of Sampling			
No.	Monitoring Location	Latitude	Longitude	Round-1	Round-2	Round-3	
1.	Near main gate Gharda Chemicals	19°13'10.45"N	73°6'50.33"E	07.05.2025	09.05.2025	11.05.2025	
2.	Near main gate DEBESA CETP	19°13'0.45"N	73°6'18.07"E	07.05.2025	09.05.2025	11.05.2025	
3.	Near main gate Balkrishna Industries Ltd.	19°12'36.40"N	73°6'41.92"E	07.05.2025	09.05.2025	11.05.2025	
4.	Near main gate Sagar Ice & Cold Storage Pvt. Ltd.	19°12'55.54"N	73°6'26.29"E	07.05.2025	09.05.2025	11.05.2025	

Table 5.2 Phase I - Details of Sampling Location of Volatile Organic Compounds (VOCs) Monitoring

Sr.	Name of	Latitude	Longitudo	Date of Sampling			
No.	Monitoring Location	Latitude	Longitude	Round-1	Round-2	Round-3	
1.	Near main gate Gharda Chemicals	19°13'10.45"N	73°6'50.33"E	07.05.2025	09.05.2025	11.05.2025	
2.	Near main gate DEBESA CETP	19°13'0.45"N	73°6'18.07"E	07.05.2025	09.05.2025	11.05.2025	

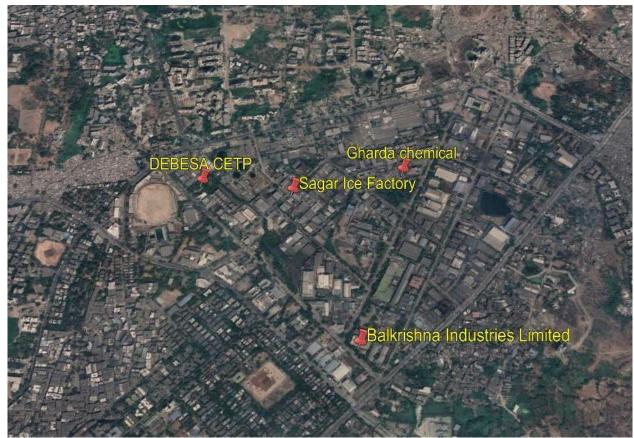


Fig. Geographical Locations of Ambient Air Quality Monitoring MIDC Dombivali Phase I



Fig. Geographical Locations of VOCs Monitoring MIDC Dombivali Phase I

Table 5.3 Phase I - Results of Ambient Air Quality Monitoring

			Res	sults	
Parameters	Unit	Gharda Chemicals	DEBESA CETP	Balkrishna Industries Ltd.	Sagar Ice & Cold Storage Pvt. Ltd.
Sulphur Dioxide (SO ₂)	μg/m³	BLQ	BLQ	BLQ	BLQ
Nitrogen Dioxide (NO ₂)	μg/m³	24	32	23	31
Particulate Matter (size less than 10 µm) or PM ₁₀	μg/m³	47	42	38	38
Particulate Matter (size less than 2.5 µm) or PM _{2.5}	μg/m³	12	12	11	11
Ozone (O ₃)	μg/m³	BLQ	BLQ	BLQ	BLQ
Lead (Pb)	μg/m³	BLQ	BLQ	BLQ	BLQ
Carbon Monoxide (CO) (1 h)	mg/m³	1.2	1.3	1.3	1.3
Carbon Monoxide (CO) (8 h)	mg/m³	2	2	1	2
Ammonia (NH ₃)	μg/m³	23	BLQ	26	25
Benzene (C ₆ H ₆)	μg/m³	2.0	1.9	2.1	1.9
Benzo (a) Pyrene (BaP) – particulate phase only	ng/m³	BLQ	BLQ	BLQ	BLQ
Arsenic (As)	ng/m³	BLQ	BLQ	BLQ	BLQ
Nickel (Ni)	ng/m³	3.16	3.18	BLQ	BLQ


Table 5.4 Phase I - Volatile Organic Compounds (VOCs) in Ambient Air Results


Dawanashawa	11	Results		
Parameters	Unit	Gharda Chemicals	DEBESA CETP	
Dichloromethane	μg/m³	0.8	3.1	
Chloroform	μg/m³	BLQ	BLQ	
Carbon Tetrachloride	μg/m³	BLQ	BLQ	
Trichloroethylene	μg/m³	BLQ	BLQ	
Bromodichloromethane	μg/m³	BLQ	BLQ	
1,3-Dichloropropane	μg/m³	BLQ	BLQ	
1,4-Dichlorobenzene	μg/m³	BLQ	BLQ	
1,3-Dichlorobenzene	μg/m³	BLQ	BLQ	
1,2-Dichlorobenzene	µg/m³	BLQ	BLQ	
1,2-Dibromo-3-Chloropropane	µg/m³	BLQ	BLQ	
Naphthalene	μg/m³	BLQ	BLQ	
Bromobenzene	μg/m³	BLQ	BLQ	


D	1124	Results		
Parameters	Unit	Gharda Chemicals	DEBESA CETP	
1,2,4-Trimethylbenzene	μg/m³	BLQ	BLQ	
2-Chlorotoluene	μg/m³	BLQ	BLQ	
Tert-Butylbenzene	μg/m³	BLQ	BLQ	
SEC-Butylbenzene	μg/m³	BLQ	BLQ	
P-Isopropyl toluene	μg/m³	BLQ	BLQ	
M-Xylene	μg/m³	BLQ	BLQ	
P-Xylene	μg/m³	BLQ	1.43	
Styrene	μg/m³	BLQ	0.628	
Cumene	μg/m³	BLQ	BLQ	
1,2,3-Trichloropropane	μg/m³	BLQ	BLQ	
N-Propyl benzene	μg/m³	BLQ	BLQ	
Dibromochloromethane	μg/m³	BLQ	BLQ	
1,2-Dibromoethane	μg/m³	BLQ	BLQ	
Chlorobenzene	μg/m³	BLQ	BLQ	
1,1,1,2-Tetrachloroethane	μg/m³	BLQ	BLQ	
Ethylbenzene	μg/m³	BLQ	BLQ	
1,1-Dichloropropylene	μg/m³	BLQ	BLQ	
1,2-Dichloroethane	μg/m³	BLQ	BLQ	
1,2-Dichloropropane	μg/m³	BLQ	BLQ	
Trans-1,3-Dichloropropene	μg/m³	BLQ	BLQ	
CIS 1,3-Dichloropropene	μg/m³	BLQ	BLQ	
1,1,2-Trichloroethane	μg/m³	BLQ	BLQ	
Tetrachloroethylene	μg/m³	BLQ	BLQ	
1,3,5-Trimethylbenzene	μg/m³	BLQ	BLQ	
N-Butylbenzene	μg/m³	BLQ	BLQ	
1,2,3-Trichlorobenzene	μg/m³	BLQ	BLQ	
Hexachlorobutadiene	μg/m³	BLQ	BLQ	
1,2,4-Trichlorobenzene	μg/m³	BLQ	BLQ	
2,2-Dichloropropane	μg/m³	BLQ	BLQ	
Dibromo methane	μg/m³	BLQ	BLQ	
Toluene	μg/m³	0.854	2.525	
O-Xylene	μg/m³	BLQ	BLQ	


Davamahaya	lla:t	Results		
Parameters	Unit	Gharda Chemicals	DEBESA CETP	
Bromoform	μg/m³	BLQ	BLQ	
1,1,2,2-Tetrachloroethane	μg/m³	BLQ	BLQ	
4-Chlorotoluene	μg/m³	BLQ	BLQ	
1,1-Dichloroethylene	μg/m³	BLQ	BLQ	
Trans-1,2-Dichloroethylene	μg/m³	BLQ	BLQ	
1,1-Dichloroethane	μg/m³	BLQ	BLQ	
CIS-1,2-Dichloroethylene	μg/m³	BLQ	BLQ	
Bromochloromethane	μg/m³	BLQ	BLQ	
1,1,1-Trichloroethane	μg/m³	BLQ	BLQ	


Graphs - Ambient Air Quality of MIDC Dombivali Phase I

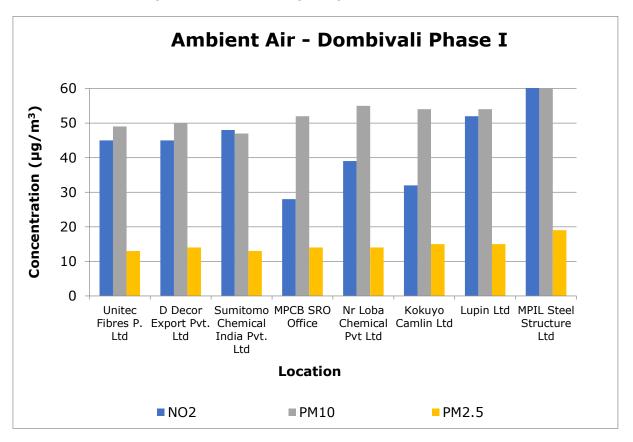

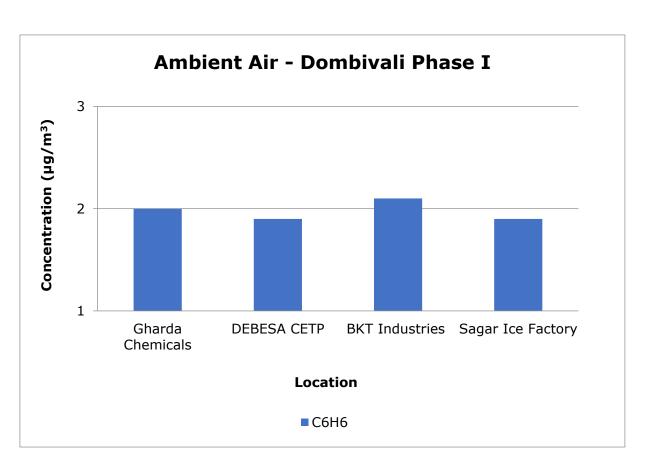

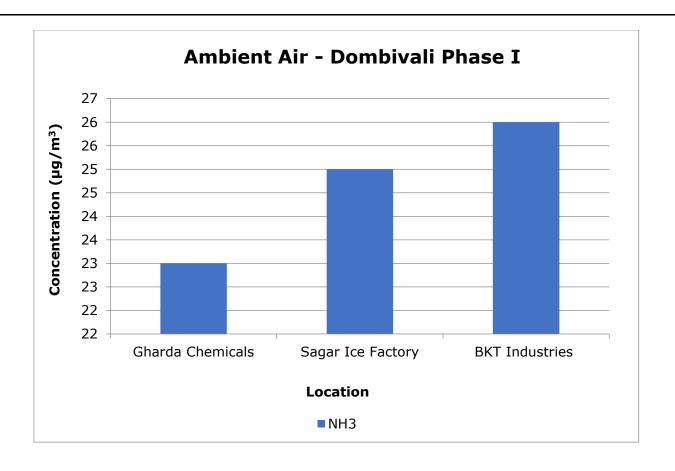

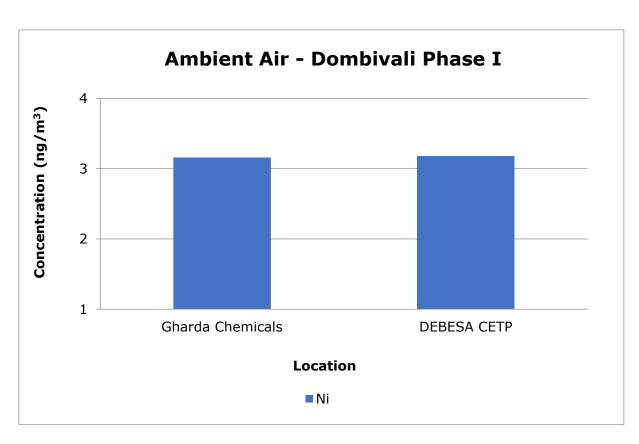

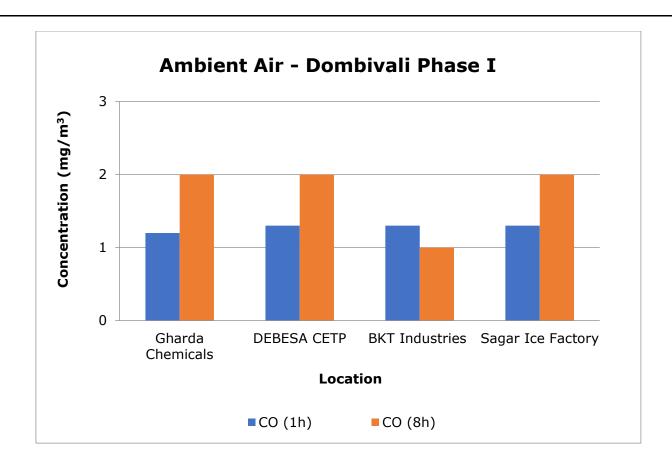

2. <u>MIDC Phase II:</u> In MIDC Phase II of Dombivali also all 4 locations monitored. Samples were taken in triplicate from 07th May to 12th May 2025. Concentration of all the parameters were found within the limits mentioned under NAAQS, 2009.

Table 5.5 Phase II - Details of Sampling Location of Ambient Air Quality Monitoring

Sr.	Name of	l skiku da	Lamaikuda	Date of Sampling			
No	Monitoring Location	Latitude	Longitude	Round-1	Round-2	Round-3	
1.	Near main gate Dombivali Common Effluent Treatment Plant	19°12'17.37"N	73° 5'58.34"E	07.05.2025	09.05.2025	11.05.2025	
2.	Behind Connect well Industries Pvt. Ltd.	19°11'37.12"N	73° 5'39.80"E	07.05.2025	09.05.2025	11.05.2025	
3.	Near main gate Metropolitan Eximchem Ltd.	19°12'7.89"N	73° 5'56.18"E	07.05.2025	09.05.2025	11.05.2025	
4.	Near main gate Apartim Equipment	19°12'22.33"N	73° 6'1.31"E	07.05.2025	09.05.2025	11.05.2025	

Table 5.6 Phase II - Details of Sampling Location of Volatile Organic Compounds
(VOCs) Monitoring

Sr.	Name of	I akiku da	1	Date of Sampling			
No	Monitoring Location	Latitude	Longitude	Round-1	Round-2	Round-3	
1.	Near main gate Dombivali Common Effluent Treatment Plant	19°12'17.37"N	73° 5'58.34"E	07.05.2025	09.05.2025	11.05.2025	
2.	Behind Connect well Industries Pvt. Ltd.	19°11'37.12"N	73° 5'39.80"E	07.05.2025	09.05.2025	11.05.2025	



Fig. Geographical Locations of Ambient Air Quality Monitoring MIDC Dombivali Phase II

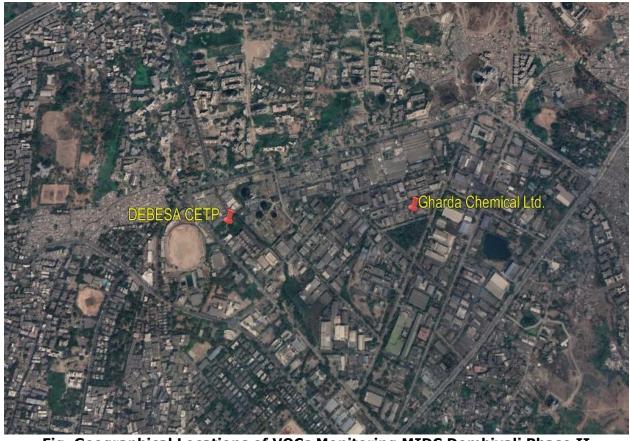


Fig. Geographical Locations of VOCs Monitoring MIDC Dombivali Phase II

Table 5.7 Phase II - Results of Ambient Air Quality Monitoring

		Results						
Parameters	Unit	Dombivali CETP	Connect well Industries Pvt. Ltd.	Metropolitan Eximchem Ltd.	Apartim Equipment			
Sulphur Dioxide (SO ₂)	μg/m³	BLQ	BLQ	BLQ	BLQ			
Nitrogen Dioxide (NO ₂)	μg/m³	17	19	24	21			
Particulate Matter (size less than 10 µm) or PM ₁₀	μg/m³	41	42	44	42			
Particulate Matter (size less than 2.5 μm) or PM _{2.5}	μg/m³	12	12	13	12			
Ozone (O ₃)	μg/m³	BLQ	BLQ	BLQ	BLQ			
Lead (Pb)	μg/m³	BLQ	BLQ	BLQ	BLQ			
Carbon Monoxide (CO) (1 h)	mg/m³	1.2	1.1	1.4	1.1			
Carbon Monoxide (CO) (8 h)	mg/m³	2	1	2	1			
Ammonia (NH ₃)	μg/m³	22	BLQ	24	24			
Benzene (C ₆ H ₆)	μg/m³	2.0	2.0	2.0	1.9			
Benzo (a) Pyrene (BaP) – particulate phase only	ng/m³	BLQ	BLQ	BLQ	BLQ			
Arsenic (As)	ng/m³	BLQ	BLQ	BLQ	BLQ			
Nickel (Ni)	ng/m³	3.71	3.41	3.62	4.02			


Table 5.8 Phase I - Volatile Organic Compounds (VOCs) in Ambient Air Results


		Resu	ilts	
Parameters	Unit	Dombivali CETP	Connect well Industries Pvt. Ltd.	
Dichloromethane	μg/m³	BLQ	BLQ	
Chloroform	μg/m³	BLQ	BLQ	
Carbon Tetrachloride	μg/m³	BLQ	BLQ	
Trichloroethylene	μg/m³	BLQ	BLQ	
Bromodichloromethane	μg/m³	BLQ	BLQ	
1,3-Dichloropropane	μg/m³	BLQ	BLQ	
1,4-Dichlorobenzene	μg/m³	BLQ	BLQ	
1,3-Dichlorobenzene	μg/m³	BLQ	BLQ	
1,2-Dichlorobenzene	μg/m³	BLQ	BLQ	
1,2-Dibromo-3-Chloropropane	μg/m³	BLQ	BLQ	
Naphthalene	μg/m³	BLQ	BLQ	
Bromobenzene	μg/m³	BLQ	BLQ	


		Results			
Parameters	Unit	Dombivali CETP	Connect well Industries Pvt. Ltd.		
1,2,4-Trimethylbenzene	µg/m³	BLQ	BLQ		
2-Chlorotoluene	µg/m³	BLQ	0.615		
Tert-Butylbenzene	µg/m³	BLQ	1.45		
SEC-Butylbenzene	μg/m³	BLQ	1.31		
P-Isopropyl toluene	μg/m³	BLQ	BLQ		
M-Xylene	μg/m³	BLQ	BLQ		
P-Xylene	μg/m³	1.178	BLQ		
Styrene	μg/m³	BLQ	BLQ		
Cumene	μg/m³	BLQ	BLQ		
1,2,3-Trichloropropane	μg/m³	BLQ	BLQ		
N-Propyl benzene	μg/m³	BLQ	BLQ		
Dibromochloromethane	μg/m³	BLQ	BLQ		
1,2-Dibromoethane	μg/m³	BLQ	1.01		
Chlorobenzene	μg/m³	BLQ	BLQ		
1,1,1,2-Tetrachloroethane	μg/m³	BLQ	0.755		
Ethylbenzene	μg/m³	BLQ	BLQ		
1,1-Dichloropropylene	μg/m³	BLQ	BLQ		
1,2-Dichloroethane	μg/m³	BLQ	BLQ		
1,2-Dichloropropane	μg/m³	BLQ	BLQ		
Trans-1,3-Dichloropropene	μg/m³	BLQ	1.19		
CIS 1,3-Dichloropropene	μg/m³	BLQ	BLQ		
1,1,2-Trichloroethane	μg/m³	BLQ	BLQ		
Tetrachloroethylene	μg/m³	BLQ	BLQ		
1,3,5-Trimethylbenzene	μg/m³	BLQ	BLQ		
N-Butylbenzene	μg/m³	BLQ	BLQ		
1,2,3-Trichlorobenzene	μg/m³	BLQ	BLQ		
Hexachlorobutadiene	μg/m³	BLQ	BLQ		
1,2,4-Trichlorobenzene	μg/m³	BLQ	4.58		
2,2-Dichloropropane	μg/m³	BLQ	1.43		
Dibromo methane	μg/m³	2.37	BLQ		
Toluene	μg/m³	BLQ	BLQ		
O-Xylene	μg/m³	BLQ	BLQ		


		Results			
Parameters	Unit	Dombivali CETP	Connect well Industries Pvt. Ltd.		
Bromoform	μg/m³	BLQ	BLQ		
1,1,2,2-Tetrachloroethane	μg/m³	BLQ	BLQ		
4-Chlorotoluene	μg/m³	BLQ	BLQ		
1,1-Dichloroethylene	μg/m³	BLQ	BLQ		
Trans-1,2-Dichloroethylene	μg/m³	BLQ	0.5		
1,1-Dichloroethane	μg/m³	BLQ	BLQ		
CIS-1,2-Dichloroethylene	μg/m³	BLQ	BLQ		
Bromochloromethane	μg/m³	BLQ	0.5		
1,1,1-Trichloroethane	μg/m³	BLQ	BLQ		


Graphs - Ambient Air Quality of MIDC Dombivali Phase II

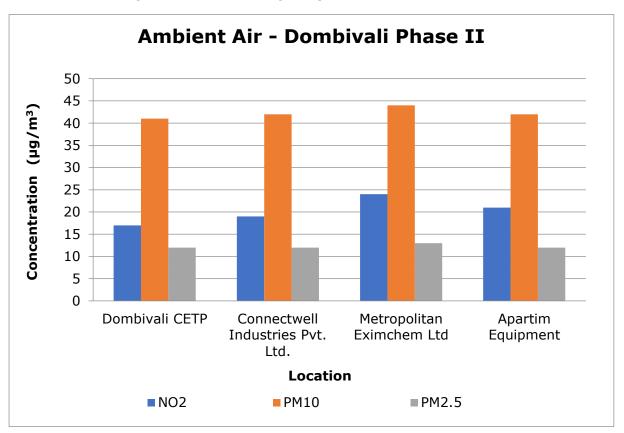


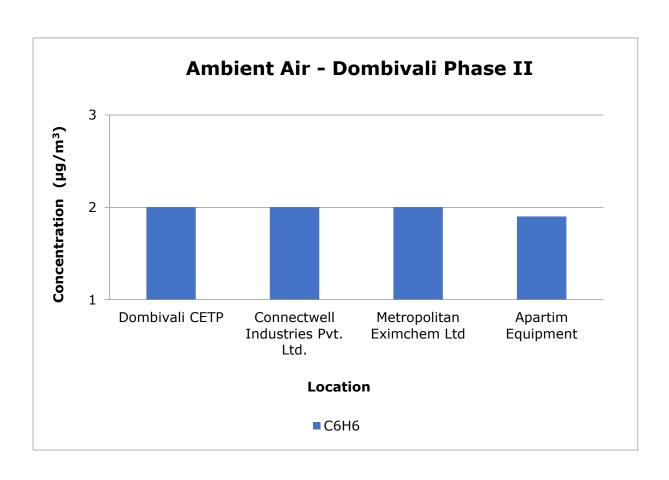

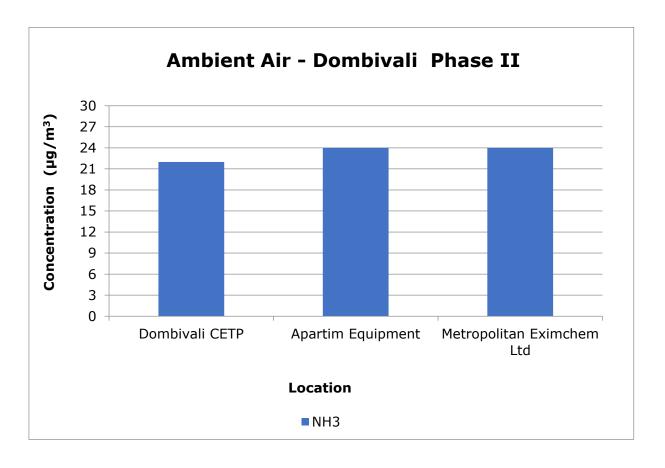

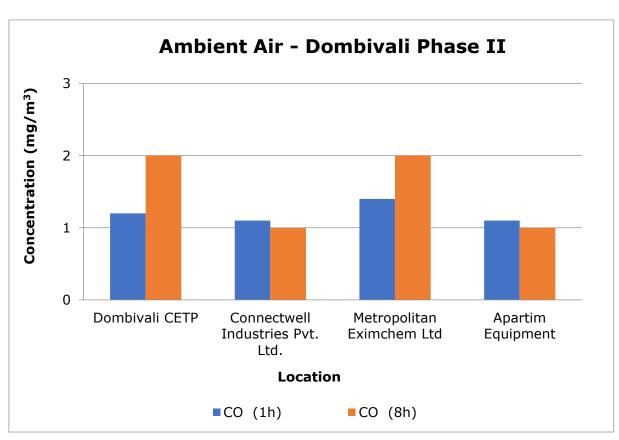

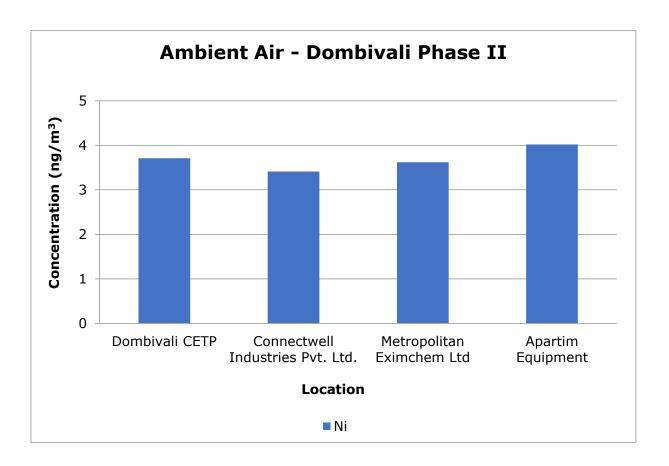

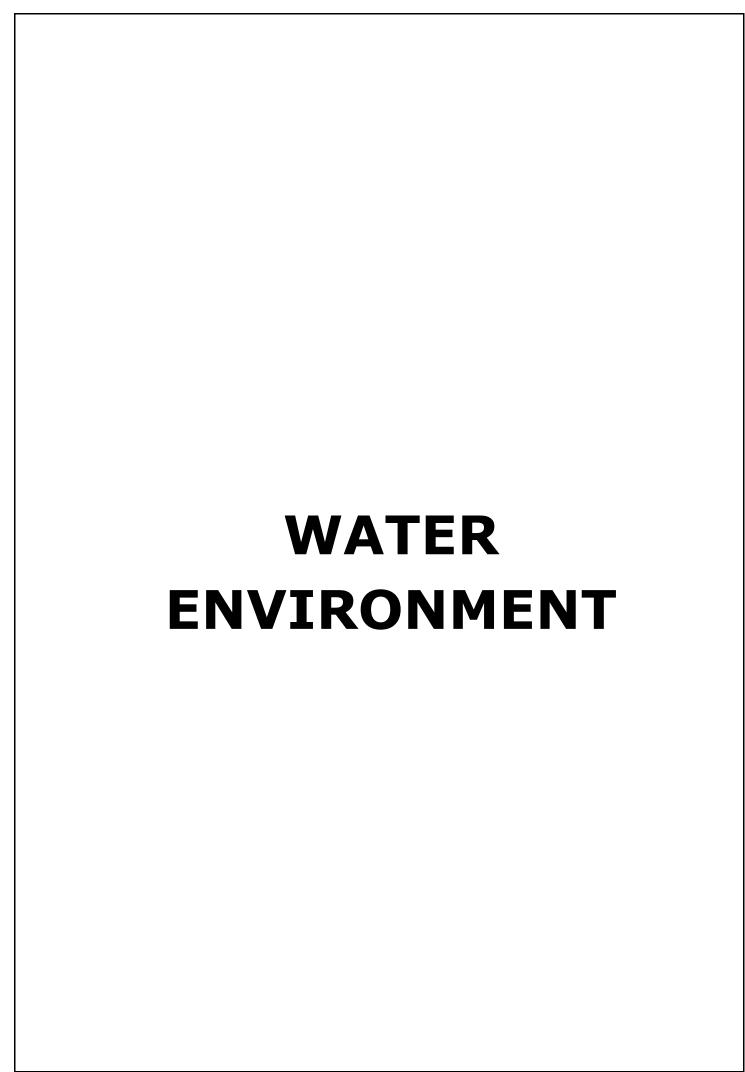

6. Water Environment

For studying the water Environment of Dombivali area, surface water was collected from Nallah, Lake, and River and CETP outlet. A total of 12 samples were collected from MIDC Phase I and MIDC Phase II of Dombivali.

- 1. <u>MIDC Phase I</u>: Six surface water samples are collected from the Dombivali MIDC Phase I region.
 - No floating matter was observed in any of the water samples. The smell was agreeable in all
 the samples except Drain Flowing from DEBESA CETP, Near Khambal Pada and Nallah nearby
 Krishna Alkali Pvt. Ltd. water samples.
 - pH and suspended solids are well within the limits of all the collected samples.
 - Except Thakurli Talav, all other water samples were found to exceed the permissible limit of BOD concentration.
 - 100% survival was achieved in Fish Bioassay in the water sample collected from Thakurli Talav only. All other water samples were observed with a fish bioassay survival in the range of 80%-97%.
 - Concentration of all other metals like Arsenic, Vanadium, Selenium, Boron and Hexavalent Chromium (Cr⁶⁺) etc. are observed either below the limit of quantification or below their standard limits.
 - Parameters like Total Residual Chlorine, Cyanide, Sulphide, Dissolved Phosphate, Total Ammonical Nitrogen and Phenolic compounds also met the criteria as prescribed by CPCB.
 - Polynuclear aromatic hydrocarbons (PAH) and Polychlorinated Biphenyls (PCB) are below the limit of quantification in all 6 samples collected.
 - Organo Chlorine Pesticides are also below the limit of quantification (BLQ) in all 6 samples collected.

Table 6.1 Phase I – Details of Sampling Location of Surface Water

Sr.	Name of Monitoring	Latitude	Longitude	Date of Sampling			
No.	Location	Latitude	Longitude	Round-1	Round-2	Round-3	
1.	Drain Flowing from DEBESA CETP	19°12'59.98"N	73°6'21.74"E	08.05.2025	10.05.2025	12.05.2025	
2.	Near Khambal Pada	19°13'49.19"N	73°6'19.11"E	08.05.2025	10.05.2025	12.05.2025	

Sr.	Name of Monitoring	Latitude	Longitude	Date of Sampling			
No.	Location	Latitude	Longitude	Round-1	Round-2	Round-3	
3.	Thakurli Talav	19°13'19.42"N	73°5'57.92"E	08.05.2025	10.05.2025	12.05.2025	
4.	Storm Water DEBESA CETP Nallah	19°12'58.47"N	73°6'56.60"E	08.05.2025	10.05.2025	12.05.2025	
5.	Nallah nearby Gharda Chemical Ltd.	19°13'2.87"N	73°6'44.41"E	08.05.2025	10.05.2025	12.05.2025	
6.	Nallah nearby Krishna Alkali Pvt. Ltd.	19°13'1.18"N	73°6'38.89"E	08.05.2025	10.05.2025	12.05.2025	



Fig. Geographical Locations of Surface Water Sampling MIDC Dombivali Phase I

Table 6.2 Phase I – Results of Surface Water


	Unit	Results							
Parameters		Drain Flowing from DEBESA CETP	Near Khambal Pada	Thakurli Talav	Storm Water DEBESA CETP Nallah	Gharda Chemica I Ltd.	Krishna Alkali Pvt. Ltd.		
Sanitary Survey	-	Reasonabl y clean neighbour hood	Reasonabl y clean neighbour hood	Reasonabl y clean neighbour hood	Reasona bly clean neighbou rhood	Reasona bly clean neighbou rhood	Reasona bly clean neighbou rhood		


		Results							
Parameters	Unit	Drain Flowing from DEBESA CETP	Near Khambal Pada	Thakurli Talav	Storm Water DEBESA CETP Nallah	Gharda Chemica I Ltd.	Krishna Alkali Pvt. Ltd.		
General Appearance	-	No Floating Matter	No Floating Matter	No Floating Matter	No Floatin g Matter	No Floatin g Matter	No Floatin g Matter		
Transparency	m	0.3	0.2	0.26666 6667	0.3	0.3	0.2		
Temperature	°C	28	28	29	28	28	28		
Colour	Hazen	1	1	1	3	1	1		
Smell	-	Not Agreeable	Not Agreeable	Agreeable	Agreeable	Agreeable	Not Agreeable		
pН	-	7.4	7.7	7.7	7.6	7.8	7.5		
Oil & Grease	mg/L	BLQ	BLQ	BLQ	BLQ	BLQ	BLQ		
Suspended Solids	mg/L	14	23	22	25	11	17		
Total Dissolved Solids	mg/L	636	281	145	181	217	225		
Dissolved Oxygen (% Saturation)	%	64	65	72	65	59	66		
Chemical Oxygen Demand	mg/L	36	29	20	29	124	32		
Biochemical Oxygen Demand (3 days,27°C)	mg/L	9	8	5	8	42	8		
Electrical Conductivity (at 25 °C)	µmho/ cm	1135	503	259	325	389	404		
Nitrite Nitrogen (as NO ₂)	mg/L	BLQ	0.04	BLQ	0.095	BLQ	0.02		
Nitrate Nitrogen (as NO ₃)	mg/L	1.1	0.9	0.5	1.0	0.7	1.2		
(NO ₂ + NO ₃)- Nitrogen	mg/L	1.1	0.9	0.5	1.1	0.7	1.3		
Free Ammonia (as NH ₃ -N)	mg/L	BLQ	BLQ	BLQ	BLQ	BLQ	BLQ		
Total Residual Chlorine	mg/L	BLQ	BLQ	BLQ	BLQ	BLQ	BLQ		
Cyanide (as CN)	mg/L	BLQ	BLQ	BLQ	BLQ	BLQ	BLQ		
Fluoride (as F)	mg/L	1	1	1	1	1	1		
Sulphide (as H ₂ S)	mg/L	BLQ	BLQ	BLQ	BLQ	BLQ	BLQ		
Dissolved Phosphate (as P)	mg/L	0.14	BLQ	BLQ	BLQ	BLQ	BLQ		


		Results						
Parameters	Unit	Drain Flowing from DEBESA CETP	Near Khambal Pada	Thakurli Talav	Storm Water DEBESA CETP Nallah	Gharda Chemica I Ltd.	Krishna Alkali Pvt. Ltd.	
Sodium Adsorption Ratio	-	4.8	2.5	1.3	1.6	1.6	1.8	
Total Coliforms	MPN Index/ 100 ml	6400	6383	5458	4767	5757	137	
Faecal Coliforms	MPN Index/ 100 ml	566	1027	205	203	154	70	
Total Phosphate (as P)	mg/L	0.3	0.2	BLQ	0.1	0.1	0.2	
Total Kjeldahl Nitrogen (as N)	mg/L	1.5	0.6	0.8	1.8	0.6	1.1	
Total Ammonia (NH4+NH3)- Nitrogen	mg/L	1.6	1.7	0.4	1.3	3.9	0.2	
Total Nitrogen	mg/L	2.5	2.0	2.1	3.0	1.5	2.3	
Phenols (as C ₆ H ₅ OH)	mg/L	BLQ	BLQ	BLQ	BLQ	BLQ	BLQ	
Anionic Detergents (as MBAS Calculated as LAS, mol.wt.288.38	mg/L	BLQ	BLQ	BLQ	BLQ	BLQ	BLQ	
Organo Chlorine Pesticides	μg/L	BLQ	BLQ	BLQ	BLQ	BLQ	BLQ	
Polynuclear aromatic hydrocarbons (as PAH)	mg/L	BLQ	BLQ	BLQ	BLQ	BLQ	BLQ	
Polychlorinate d Biphenyls (PCB)	mg/L	BLQ	BLQ	BLQ	BLQ	BLQ	BLQ	
Zinc (as Zn)	mg/L	BLQ	BLQ	BLQ	BLQ	BLQ	BLQ	
Nickel (as Ni)	mg/L	BLQ	BLQ	BLQ	BLQ	BLQ	BLQ	
Copper (as Cu)	mg/L	BLQ	BLQ	BLQ	BLQ	BLQ	BLQ	
Hexavalent Chromium (as Cr ⁶⁺)	mg/L	BLQ	BLQ	BLQ	BLQ	BLQ	BLQ	
Total Chromium (as Cr)	mg/L	0.024	BLQ	BLQ	BLQ	BLQ	BLQ	
Total Arsenic (as As)	mg/L	BLQ	BLQ	BLQ	BLQ	BLQ	BLQ	
Lead (as Pb)	mg/L	BLQ	BLQ	BLQ	BLQ	BLQ	BLQ	
Cadmium (as Cd)	mg/L	BLQ	BLQ	BLQ	BLQ	BLQ	BLQ	


		Results						
Parameters	Unit	Drain Flowing from DEBESA CETP	Near Khambal Pada	Thakurli Talav	Storm Water DEBESA CETP Nallah	Gharda Chemica I Ltd.	Krishna Alkali Pvt. Ltd.	
Mercury (as Hg)	mg/L	BLQ	BLQ	BLQ	BLQ	BLQ	BLQ	
Manganese (as Mn)	mg/L	BLQ	BLQ	BLQ	BLQ	BLQ	BLQ	
Iron (as Fe)	mg/L	BLQ	BLQ	BLQ	BLQ	BLQ	BLQ	
Vanadium (as V)	mg/L	BLQ	BLQ	BLQ	BLQ	BLQ	BLQ	
Selenium (as Se)	mg/L	BLQ	BLQ	BLQ	BLQ	BLQ	BLQ	
Boron (as B)	mg/L	BLQ	BLQ	BLQ	BLQ	BLQ	BLQ	
Bioassay Test on fish	% surviv al	97	90	100	90	80	97	


Graphs - Surface Water Quality of MIDC Dombivali Phase I

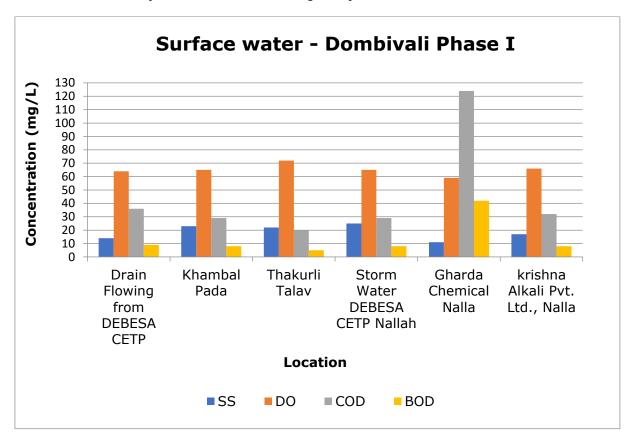


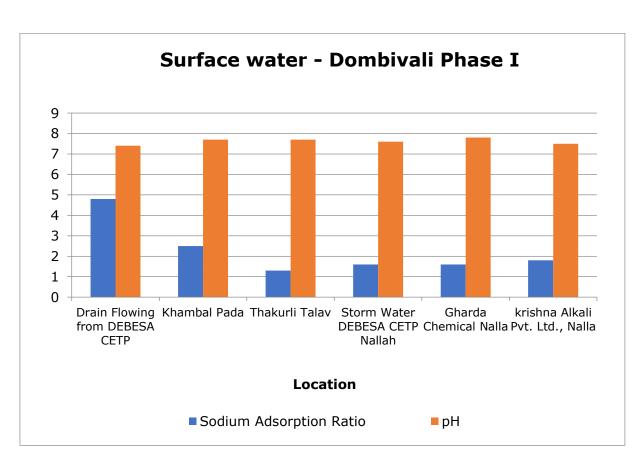

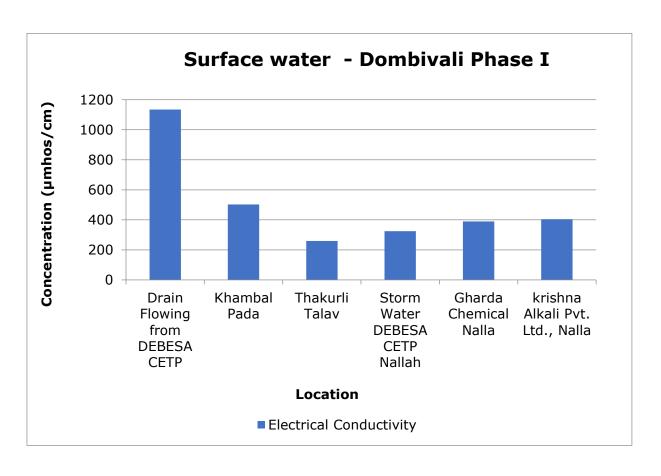

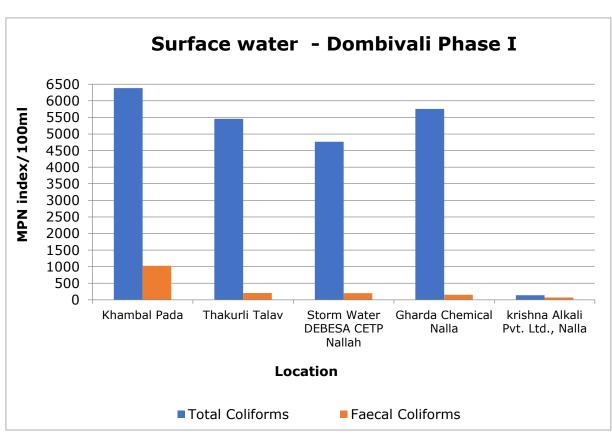

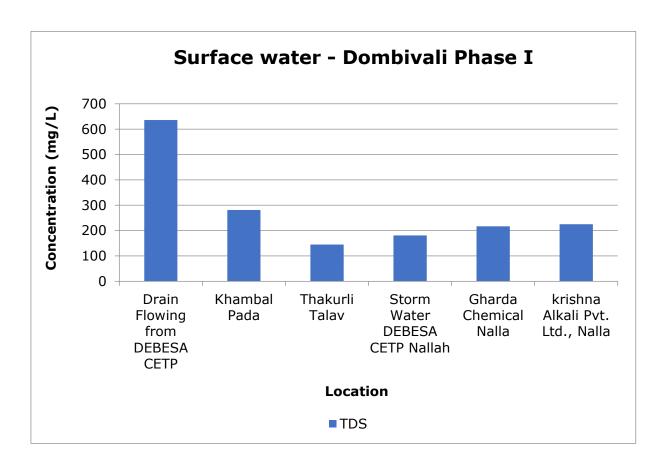

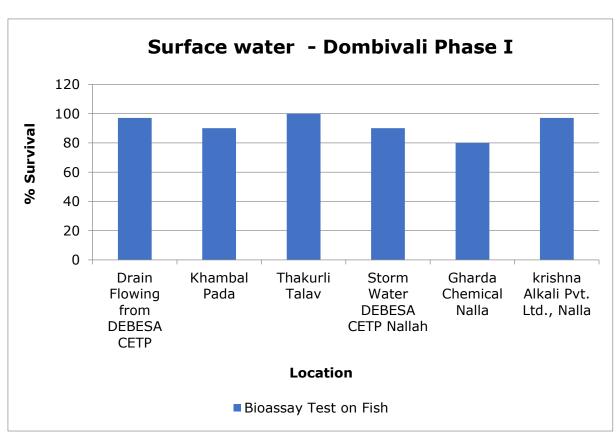

- 2. MIDC Phase II: Six surface water samples are collected from Dombivali MIDC Phase II.
 - No floating matter was observed in any of the six samples, and the odour of all the water samples is also observed as agreeable.
 - pH is observed in the range of 7.2-7.9
 - Electrical conductivity in CETP water sample is observed highest with 1962µmhos/cm.
 - Concentration of BOD and COD exceeded the acceptable limit in all six samples collected.
 - 100% fish survival was achieved in only one water sample i.e. Tempo Naka during Fish Bioassay.
 - All metals like Arsenic, Nickel, Copper, Hexavalent Chromium (Cr⁶⁺) etc. are observed either below the limit of quantification or below their standard limits.
 - Parameters like Total Residual Chlorine, Cyanide, Sulphide, Dissolved Phosphate, Total Ammoniacal Nitrogen and Phenolic compounds also met the criteria as prescribed by CPCB.
 - Polynuclear aromatic hydrocarbons (PAH) and Polychlorinated Biphenyls (PCB) are also observed below the limit of quantification (BLQ) in all the water samples.
 - Organo Chlorine Pesticides are also determined as below the limit of quantification (BLQ) in all 6 samples collected.

Table 6.3 Phase II – Details of Sampling Location of Surface Water

Sr.	Name of Monitoring	Latitude	Longitude	Date of Sampling		ng
No.	Location	Latitude	Longitude	Round-1	Round-2	Round-3
1.	Nearby Navjeevan Synthetics & Super Casting Nallah	19°11'34.57"N	73°5'20.35"E	08.05.2025	10.05.2025	12.05.2025
2.	Nallah nearby Metropolitan Exichem Ltd.	19°12'1.77"N	73°5'52.83"E	08.05.2025	10.05.2025	12.05.2025
3.	Nallah after DCETP	19°12'14.67"N	73°5'49.60"E	08.05.2025	10.05.2025	12.05.2025
4.	Nallah near Ramchandra Nagar	19°12'16.38"N	73°5'24.75"E	08.05.2025	10.05.2025	12.05.2025
5.	CETP Outlet	19°12'15.32"N	73°5'52.87"E	08.05.2025	10.05.2025	12.05.2025
6.	Tempo Naka Nallah	19°11'50.39"N	73°5'53.34"E	08.05.2025	10.05.2025	12.05.2025



Fig. Geographical Locations of Surface Water Sampling MIDC Dombivali Phase II


Table 6.4 Phase II - Results of Surface Water


			Results							
Parameters	Unit	Navjeeva n Synthetic s Pvt Ltd	Metropol itan Eximche m Ltd. Nallah	Nallah after DCETP	Ram Chandra Nagar	CETP Outlet	Tempo Naka			
Sanitary Survey	-	Reasona bly clean neighbo urhood	Reasona bly clean neighbo urhood	Reasona bly clean neighbo urhood	Reasona bly clean neighbou rhood	Reasonab ly clean neighbou rhood	Reasona bly clean neighbou rhood			
General Appearance	-	No Floating Matter	No Floating Matter	No Floating Matter	No Floating Matter	No Floating Matter	No Floating Matter			
Transparency	m	0.5	0.3	0.1	0.5	0.3	0.4			
Temperature	°C	28	29	29	28	27	29			
Colour	Hazen	1	1	1	2	3	2			
Smell	-	Agreeab le	Agreeab le	Agreeab le	Agreeabl e	Agreea ble	Agreea ble			
рН	-	7.9	7.5	7.7	7.7	7.6	7.2			
Oil & Grease	mg/L	BLQ	BLQ	BLQ	BLQ	BLQ	BLQ			
Suspended Solids	mg/L	0.5	0.3	0.1	0.5	0.3	0.4			
Total Dissolved Solids	mg/L	19	23	20	20	35	19			


		Results						
Parameters	Unit	Navjeeva n Synthetic s Pvt Ltd	Metropol itan Eximche m Ltd. Nallah	Nallah after DCETP	Ram Chandra Nagar	CETP Outlet	Tempo Naka	
Dissolved Oxygen (% Saturation)	%	112	89	123	160	499	96	
Chemical Oxygen Demand	mg/L	66	68	67	57	60	69	
Biochemical Oxygen Demand (3 days,27°C)	mg/L	32	24	33	69	34	21	
Electrical Conductivity (at 25 °C)	μmho/ cm	8	6	8	20	9	6	
Nitrite Nitrogen (as NO ₂)	mg/L	200	160	222	287	892	171	
Nitrate Nitrogen (as NO₃)	mg/L	0.04	0.04	0.03	0.02	0.41	0.02	
(NO ₂ + NO ₃)- Nitrogen	mg/L	0.7	0.7	0.8	0.9	2.2	0.8	
Free Ammonia (as NH ₃ -N)	mg/L	0.8	0.7	0.8	0.9	2.6	0.8	
Total Residual Chlorine	mg/L	BLQ	BLQ	BLQ	BLQ	BLQ	BLQ	
Cyanide (as CN)	mg/L	BLQ	BLQ	BLQ	BLQ	BLQ	BLQ	
Fluoride (as F)	mg/L	BLQ	BLQ	BLQ	BLQ	BLQ	BLQ	
Sulphide (as H ₂ S)	mg/L	1	1	2	1	1	1	
Dissolved Phosphate (as P)	mg/L	BLQ	BLQ	BLQ	BLQ	BLQ	BLQ	
Sodium Adsorption Ratio	-	BLQ	BLQ	BLQ	BLQ	0.11	BLQ	
Total Coliforms	MPN Index/ 100 ml	1.6	2.2	3.2	1.3	3.4	2.3	
Faecal Coliforms	MPN Index/ 100 ml	101	5683	661	1463	5434	10847	
Total Phosphate (as P)	mg/L	28	1183	130	216	164	2349	
Total Kjeldahl Nitrogen (as N)	mg/L	0.2	BLQ	BLQ	BLQ	0.3	BLQ	
Total Ammonia (NH ₄ +NH ₃)- Nitrogen	mg/L	2.1	1.4	0.5	2.7	0.8	0.9	
Total Nitrogen	mg/L	BLQ	1.2	1.7	2.2	7.0	1.8	


		Results						
Parameters	Unit	Navjeeva n Synthetic s Pvt Ltd	Metropol itan Eximche m Ltd. Nallah	Nallah after DCETP	Ram Chandra Nagar	CETP Outlet	Tempo Naka	
Phenols (as C ₆ H ₅ OH)	mg/L	BLQ	BLQ	BLQ	BLQ	BLQ	BLQ	
Anionic Detergents (as MBAS Calculated as LAS, mol.wt.288.3 8)	mg/L	BLQ	BLQ	BLQ	BLQ	BLQ	BLQ	
Organo Chlorine Pesticides	μg/L	BLQ	BLQ	BLQ	BLQ	BLQ	BLQ	
Polynuclear aromatic hydrocarbons (as PAH)	mg/L	BLQ	BLQ	BLQ	BLQ	BLQ	BLQ	
Polychlorinate d Biphenyls (PCB)	mg/L	BLQ	BLQ	BLQ	BLQ	BLQ	BLQ	
Zinc (as Zn)	mg/L	BLQ	BLQ	BLQ	BLQ	BLQ	BLQ	
Nickel (as Ni)	mg/L	BLQ	BLQ	BLQ	BLQ	BLQ	BLQ	
Copper (as Cu)	mg/L	BLQ	BLQ	BLQ	BLQ	BLQ	BLQ	
Hexavalent Chromium (as Cr ⁶⁺)	mg/L	BLQ	BLQ	BLQ	BLQ	BLQ	BLQ	
Total Chromium (as Cr)	mg/L	BLQ	BLQ	BLQ	BLQ	BLQ	BLQ	
Total Arsenic (as As)	mg/L	BLQ	BLQ	BLQ	BLQ	BLQ	BLQ	
Lead (as Pb)	mg/L	BLQ	BLQ	BLQ	BLQ	BLQ	BLQ	
Cadmium (as Cd)	mg/L	BLQ	BLQ	BLQ	BLQ	BLQ	BLQ	
Mercury (as Hg)	mg/L	BLQ	BLQ	BLQ	BLQ	BLQ	BLQ	
Manganese (as Mn)	mg/L	BLQ	BLQ	BLQ	BLQ	BLQ	BLQ	
Iron (as Fe)	mg/L	BLQ	BLQ	BLQ	BLQ	BLQ	BLQ	
Vanadium (as V)	mg/L	BLQ	BLQ	BLQ	BLQ	BLQ	BLQ	
Selenium (as Se)	mg/L	BLQ	BLQ	BLQ	BLQ	BLQ	BLQ	
Boron (as B)	mg/L	BLQ	BLQ	BLQ	BLQ	BLQ	BLQ	
Bioassay Test on fish	% surviv al	97	100	93	97	87	93	


Graphs - Surface Water Quality of MIDC Dombivali Phase II

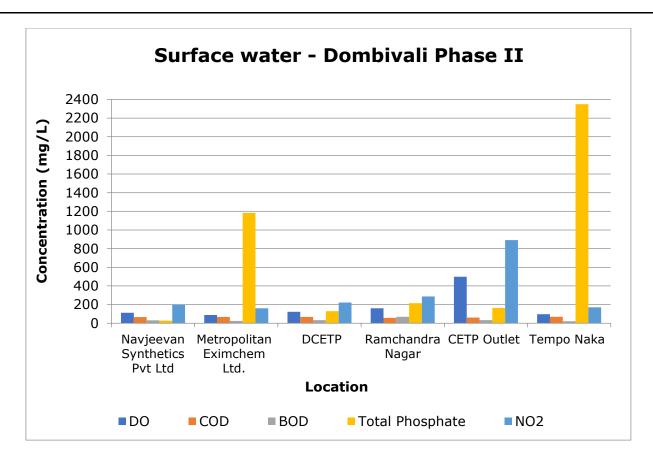


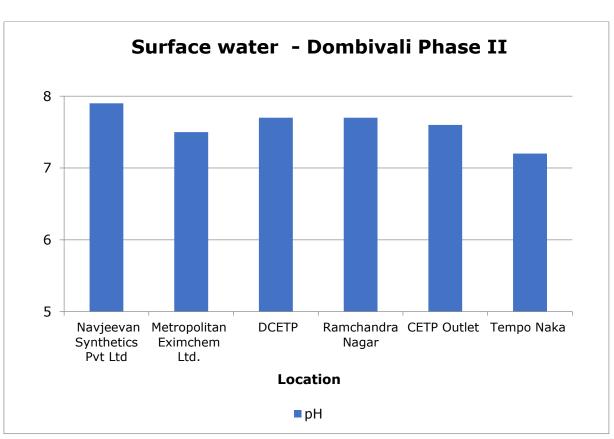


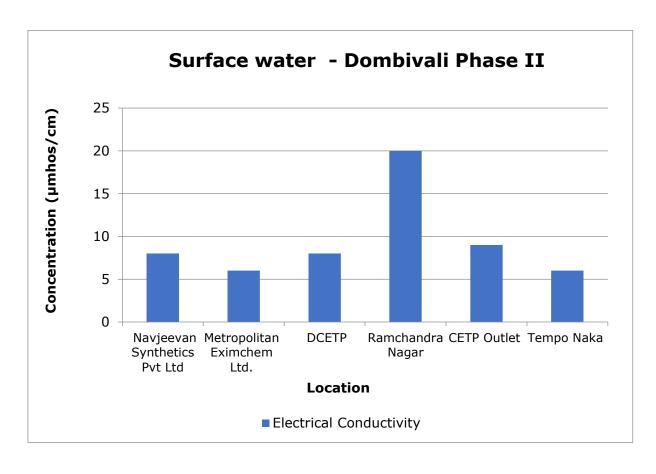

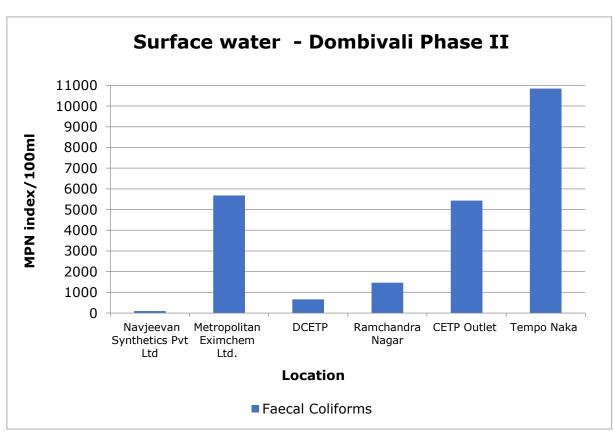

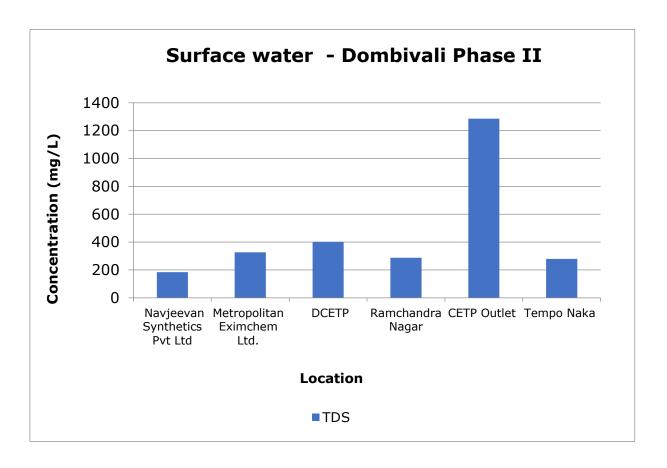

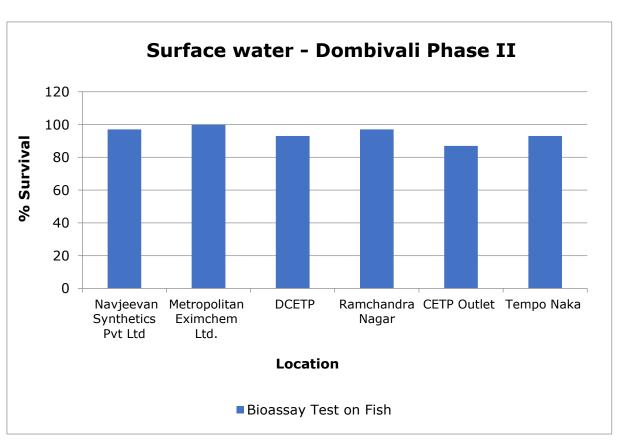

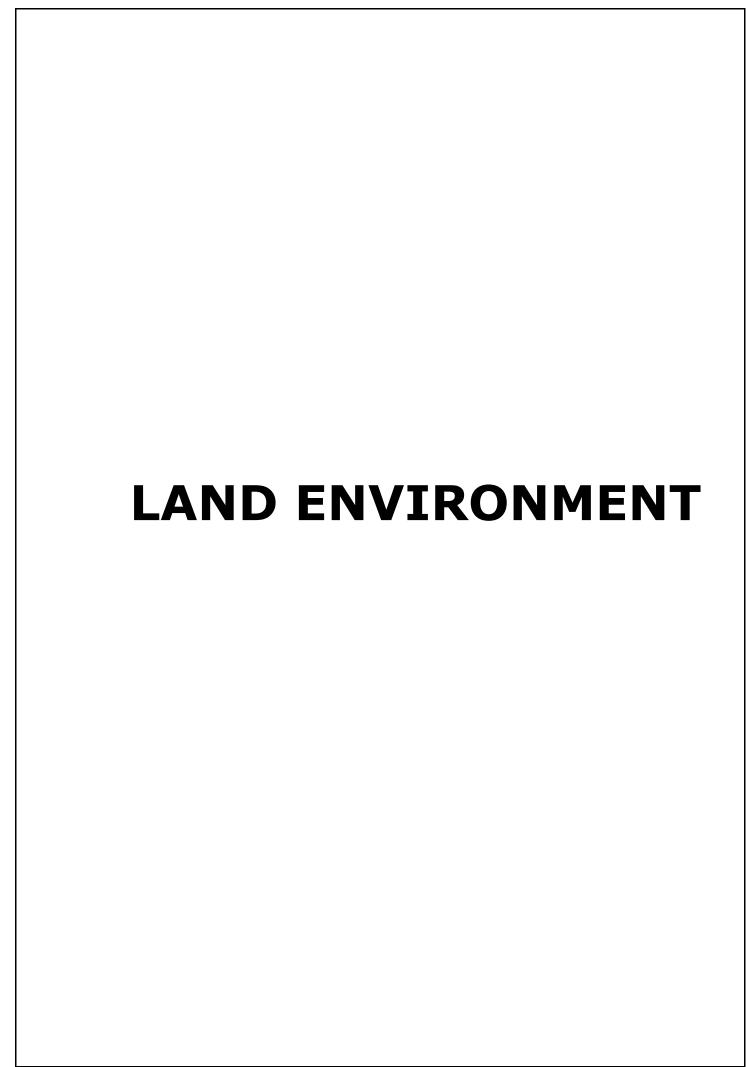

7. Land Environment

For studying the land Environment of Dombivali area, Groundwater was collected from Borewell in triplicates from 8th May to 12th May 2025. A total of 6 samples were collected from MIDC Phase I and MIDC Phase II of Dombivali region.

- **1.** <u>MIDC Phase I:</u> Three groundwater samples were collected from MIDC Phase I of the Dombivali region.
 - All three water samples collected are acceptable in general appearance, colour and transparency. Smell is agreeable except Bore well at Horizon Hall.
 - pH is observed as 7.7 of all three water samples.
 - Parameters like Total Residual Chlorine, Cyanide, Fluoride, Sulphide, Dissolved Phosphate,
 Total Ammonical Nitrogen and Phenolic compounds also meet the criteria as prescribed by CPCB.
 - 97% survival was achieved in Fish Bioassay Bore well at Horizon Hall water samples.
 - All metals like Arsenic, Nickel, Copper, Iron, Zinc, Hexavalent Chromium (Cr⁶⁺) etc. are observed either below limit of quantification or below their standard limits.
 - Polynuclear aromatic hydrocarbons (PAH) and Polychlorinated Biphenyls (PCB) were found below the limit of quantification in all 3 samples collected.
 - Organo Chlorine Pesticides were also observed below the limit of quantification in all 3 samples collected.

Table 7.1 Phase I – Details of Sampling Location of Groundwater

Sr.	Name of Monitoring	Latitude	Longitude	Da	te of Sampli	ng
No.	Location	Latitude	Longitude	Round-1	Round-2	Round-3
1.	Bore well opposite Kama Office	19°12'49.14"N	73°6'27.99"E	08.05.2025	10.05.2025	12.05.2025
2.	Bore well Near Mamata Hospital	19°12'27.36"N	73°6'15.12"E	08.05.2025	10.05.2025	12.05.2025
3.	Bore well at Horizon hall	19°11'30.01"N	73°5'31.82"E	08.05.2025	10.05.2025	12.05.2025




Fig. Geographical Locations of Groundwater Sampling MIDC Dombivali Phase I


Table 7.2 Phase I – Results of Groundwater


	Results				
Parameters	Unit	Bore well opposite Kama Office	Bore well Near Mamata Hospital	Bore well at Horizon Hall	
		Reasonably	Reasonably	Reasonably	
Sanitary Survey	-	clean neighbourhood	clean neighbourhood	clean neighbourhood	
General Appearance	-	No Floating Matter	No Floating Matter	No Floating Matter	
Transparency	m	NA	NA	NA	
Temperature	°C	28	29	27	
Colour	Hazen	1	1	1	
Smell	-	Agreeable	Agreeable	Not Agreeable	
pH	-	7.7	7.7	7.7	
Oil & Grease	mg/L	BLQ	BLQ	BLQ	
Suspended Solids	mg/L	12	21	23	
Total Dissolved Solids	mg/L	95	82	71	
Chemical Oxygen Demand	mg/L	26	34	23	
Biochemical Oxygen Demand (3 days,27°C)	mg/L	7	9	6	
Electrical Conductivity (at 25 °C)	µmho/cm	172	148	128	
Nitrite Nitrogen (as NO ₂)	mg/L	BLQ	BLQ	BLQ	
Nitrate Nitrogen (as NO ₃)	mg/L	0.64	0.66	0.60	
(NO ₂ + NO ₃)-Nitrogen	mg/L	0.64	0.66	0.60	
Free Ammonia (as NH ₃ -N)	mg/L	BLQ	BLQ	BLQ	
Total Residual Chlorine	mg/L	BLQ	BLQ	BLQ	


		Results				
Parameters	Unit	Bore well opposite Kama Office	Bore well Near Mamata Hospital	Bore well at Horizon Hall		
Cyanide (as CN)	mg/L	BLQ	BLQ	BLQ		
Fluoride (as F)	mg/L	1.30	1.18	1.31		
Sulphide (as H ₂ S)	mg/L	BLQ	BLQ	BLQ		
Dissolved Phosphate (as P)	mg/L	BLQ	BLQ	BLQ		
Sodium Adsorption Ratio	-	1.73	1.11	1.05		
Total Coliforms	MPN Index/ 100 ml	30	13	1407		
Faecal Coliforms	MPN Index/ 100 ml	9	6	166		
Total Phosphate (as P)	mg/L	BLQ	BLQ	BLQ		
Total Kjeldahl Nitrogen (as N)	mg/L	2	3	1		
Total Ammonia (NH4+NH3)-Nitrogen	mg/L	0.36	0.12	0.86		
Total Nitrogen	mg/L	2.65	3.75	2.09		
Phenols (as C ₆ H ₅ OH)	mg/L	BLQ	BLQ	BLQ		
Anionic Detergents (as MBAS Calculated as LAS, mol.wt.288.38)	mg/L	BLQ	BLQ	BLQ		
Organo Chlorine Pesticides	μg/L	BLQ	BLQ	BLQ		
Polynuclear aromatic hydrocarbons (as PAH)	mg/L	BLQ	BLQ	BLQ		
Polychlorinated Biphenyls (PCB)	mg/L	BLQ	BLQ	BLQ		
Zinc (as Zn)	mg/L	BLQ	BLQ	BLQ		
Nickel (as Ni)	mg/L	BLQ	BLQ	BLQ		
Copper (as Cu)	mg/L	BLQ	BLQ	BLQ		
Hexavalent Chromium (as Cr ⁶⁺)	mg/L	BLQ	BLQ	BLQ		
Total Chromium (as Cr)	mg/L	BLQ	BLQ	BLQ		
Total Arsenic (as As)	mg/L	BLQ	BLQ	BLQ		
Lead (as Pb)	mg/L	BLQ	BLQ	BLQ		
Cadmium (as Cd)	mg/L	BLQ	BLQ	BLQ		
Mercury (as Hg)	mg/L	BLQ	BLQ	BLQ		
Manganese (as Mn)	mg/L	BLQ	BLQ	BLQ		
Iron (as Fe)	mg/L	BLQ	BLQ	BLQ		
Vanadium (as V)	mg/L	BLQ	BLQ	BLQ		
Selenium (as Se)	mg/L	BLQ	BLQ	BLQ		
Boron (as B)	mg/L	BLQ	BLQ	BLQ		
Bioassay Test on fish	% survival	90	93	97		


Graphs - Groundwater Quality of MIDC Dombivali Phase I

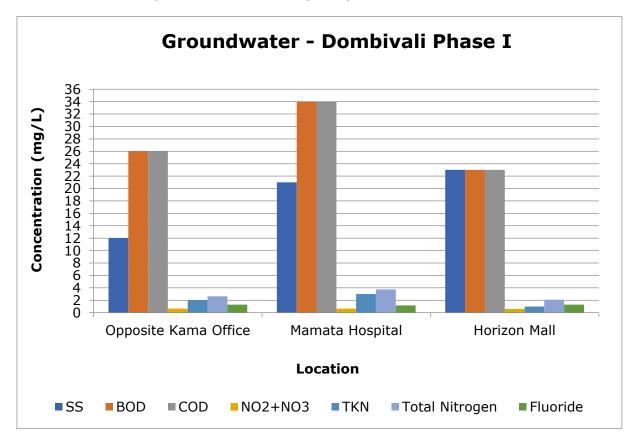


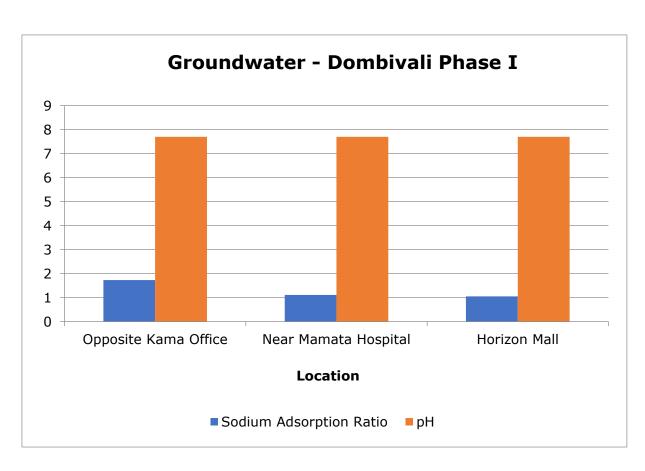

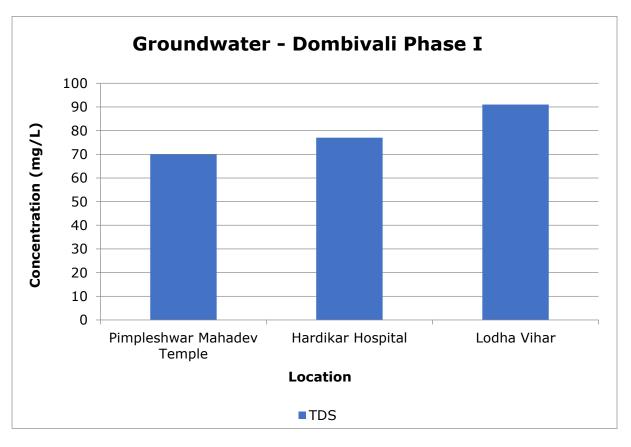

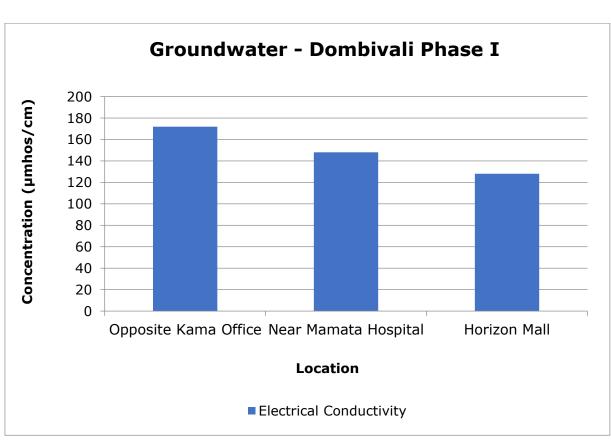

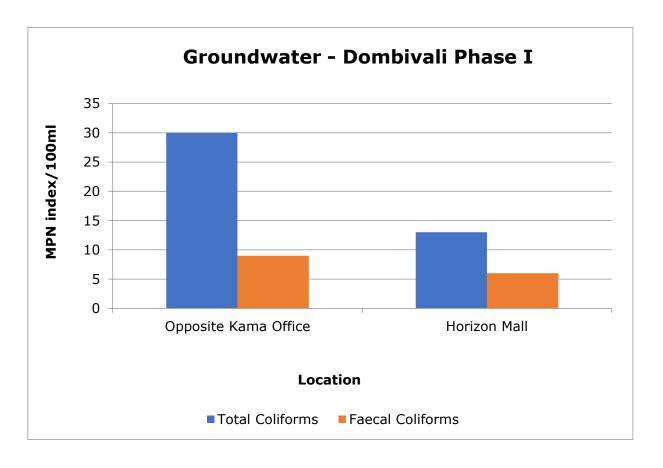

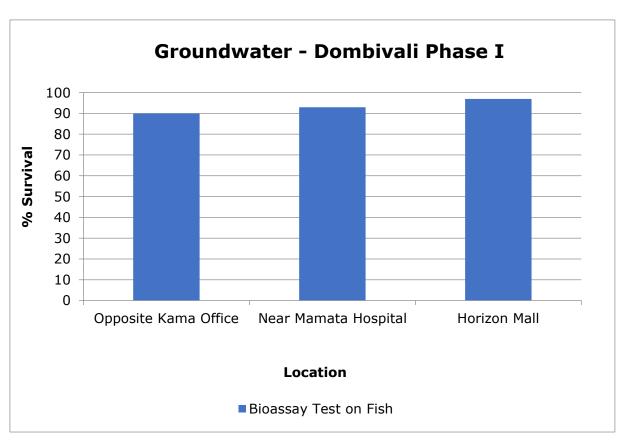

- 2. <u>MIDC Phase II:</u> From MIDC Phase II, three groundwater samples are collected.
 - All three water samples collected were found acceptable in general appearance, colour, smell and transparency.
 - pH and suspended solids were observed within the limits at both the samples collected.
 - Electrical conductivity of Borewell at Lodha Vihar was high at 31µmhos/cm.
 - Parameters like Total Residual Chlorine, Cyanide, Sulphide, Dissolved Phosphate, Total Ammonical Nitrogen and Phenolic compounds also meet the criteria as prescribed by CPCB.
 - All metals like Arsenic, Nickel, Copper, Iron, Hexavalent Chromium (Cr⁶⁺) etc. are observed either below the limit of quantification or below their standard limits.
 - Polynuclear aromatic hydrocarbons (PAH) and Polychlorinated Biphenyls (PCB) were also observed below the limit of quantification in all 3 samples collected.
 - Organo Chlorine Pesticides were also observed below the limit of quantification in all 3 samples collected.

Table 7.3 Phase II - Details of Sampling Location of Groundwater

Sr.	Name of	l stitude	Langituda	Da	te of Sampli	ng
No.	Monitoring Location	Latitude	Longitude	Round-1	Round-2	Round-3
1.	Bore well water Pimpleshwar Mahadev Temple	19°11'37.88"N	73° 5'41.06"E	08.05.2025	10.05.2025	12.05.2025
2.	Bore well Hardikar Hospital	19°12'21.16"N	73° 5'28.58"E	08.05.2025	10.05.2025	12.05.2025
3.	Borewell at Lodha Vihar	19°11'27.55"N	73° 5'15.26"E	08.05.2025	10.05.2025	12.05.2025




Fig. Geographical Locations of Groundwater Sampling MIDC Dombivali Phase II


Table 7.4 Phase II – Results of Groundwater


		Results				
Parameters	Unit	Pimpleshwar Mahadev Temple	Hardikar Hospital	Lodha Vihar		
Sanitary Survey		Reasonably clean	Reasonably clean	Reasonably clean		
Samilary Survey	_	neighbourhood	neighbourhood	neighbourhood		
General Appearance	-	No Floating Matter	No Floating Matter	No Floating Matter		
Transparency	m	NA	NA	NA		
Temperature	°C	28	29	28		
Colour	Hazen	1	1	1		
Smell	-	Agreeable	Agreeable	Agreeable		
pH	-	7.4	7.9	7.7		
Oil & Grease	mg/L	BLQ	BLQ	BLQ		
Suspended Solids	mg/L	13	11	17		
Total Dissolved Solids	mg/L	70	77	91		
Chemical Oxygen Demand	mg/L	23	24	20		
Biochemical Oxygen Demand (3 days, 27°C)	mg/L	6	6	5		
Electrical Conductivity (at 25 °C)	µmho/cm	128	126	140		
Nitrite Nitrogen (as NO ₂)	mg/L	BLQ	BLQ	BLQ		
Nitrate Nitrogen (as NO ₃)	mg/L	0.60	0.70	0.70		
(NO ₂ + NO ₃)-Nitrogen	mg/L	0.60	0.70	0.70		
Free Ammonia (as NH ₃ -N)	mg/L	BLQ	BLQ	BLQ		
Total Residual Chlorine	mg/L	BLQ	BLQ	BLQ		
Cyanide (as CN)	mg/L	BLQ	BLQ	BLQ		


			Results	
Parameters	Unit	Pimpleshwar Mahadev Temple	Hardikar Hospital	Lodha Vihar
Fluoride (as F)	mg/L	1.31	1.13	1.56
Sulphide (as H ₂ S)	mg/L	BLQ	BLQ	BLQ
Dissolved Phosphate (as P)	mg/L	BLQ	BLQ	BLQ
Sodium Adsorption Ratio	-	1.05	1.77	2.58
Total Coliforms	MPN Index/ 100 ml	1407	130	260
Faecal Coliforms	MPN Index/ 100 ml	166	4	142
Total Phosphate (as P)	mg/L	BLQ	BLQ	BLQ
Total Kjeldahl Nitrogen (as N)	mg/L	1	2	1
Total Ammonia (NH4+NH3)-Nitrogen	mg/L	0.86	0.5	0.69
Total Nitrogen	mg/L	2.09	2.35	1.46
Phenols (as C ₆ H ₅ OH)	mg/L	BLQ	BLQ	BLQ
Anionic Detergents (as MBAS Calculated as LAS, mol.wt.288.38)	mg/L	BLQ	BLQ	BLQ
Organo Chlorine Pesticides	μg/L	BLQ	BLQ	BLQ
Polynuclear aromatic hydrocarbons (as PAH)	mg/L	BLQ	BLQ	BLQ
Polychlorinated Biphenyls (PCB)	mg/L	BLQ	BLQ	BLQ
Zinc (as Zn)	mg/L	BLQ	BLQ	BLQ
Nickel (as Ni)	mg/L	BLQ	BLQ	0.016
Copper (as Cu)	mg/L	BLQ	BLQ	BLQ
Hexavalent Chromium (as Cr ⁶⁺)	mg/L	BLQ	BLQ	BLQ
Total Chromium (as Cr)	mg/L	BLQ	BLQ	BLQ
Total Arsenic (as As)	mg/L	BLQ	BLQ	BLQ
Lead (as Pb)	mg/L	BLQ	BLQ	BLQ
Cadmium (as Cd)	mg/L	BLQ	BLQ	BLQ
Mercury (as Hg)	mg/L	BLQ	BLQ	BLQ
Manganese (as Mn)	mg/L	BLQ	BLQ	BLQ
Iron (as Fe)	mg/L	BLQ	BLQ	BLQ
Vanadium (as V)	mg/L	BLQ	BLQ	BLQ
Selenium (as Se)	mg/L	BLQ	BLQ	BLQ
Boron (as B)	mg/L	BLQ	BLQ	BLQ
Bioassay Test on fish	% survival	97	93	90


Graphs - Groundwater Quality of MIDC Dombivali Phase II

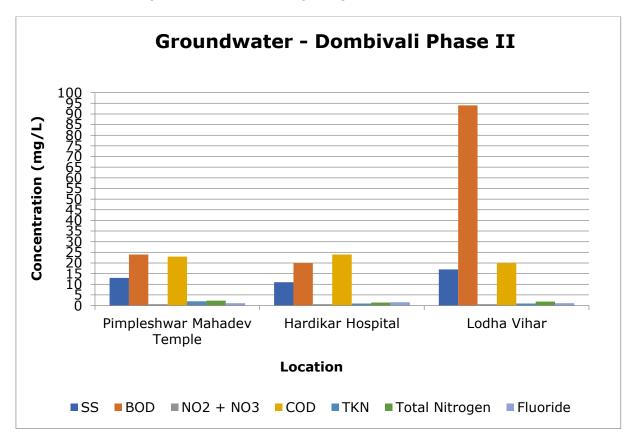


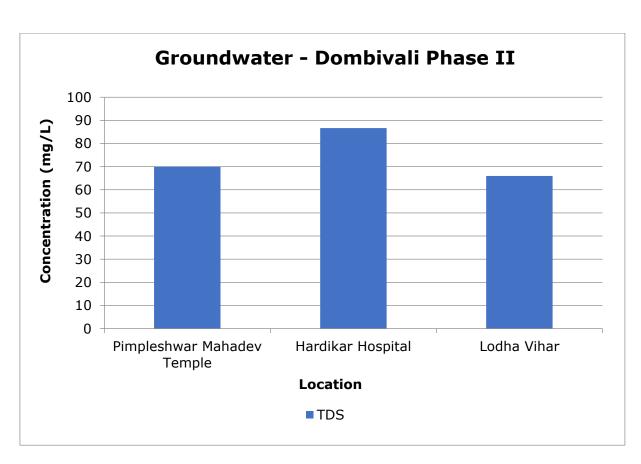

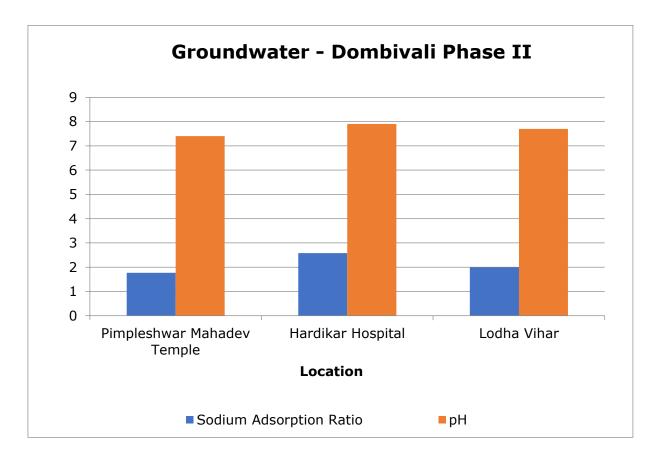

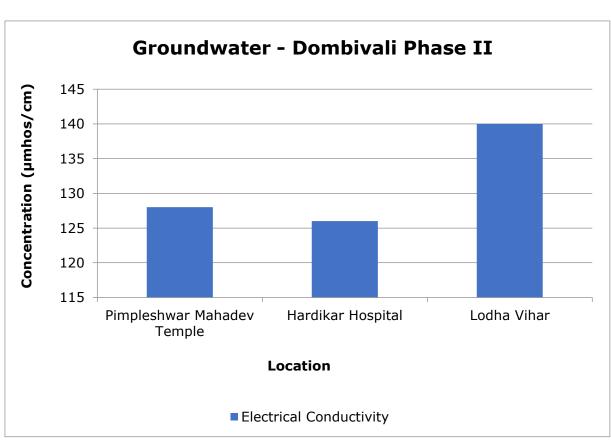

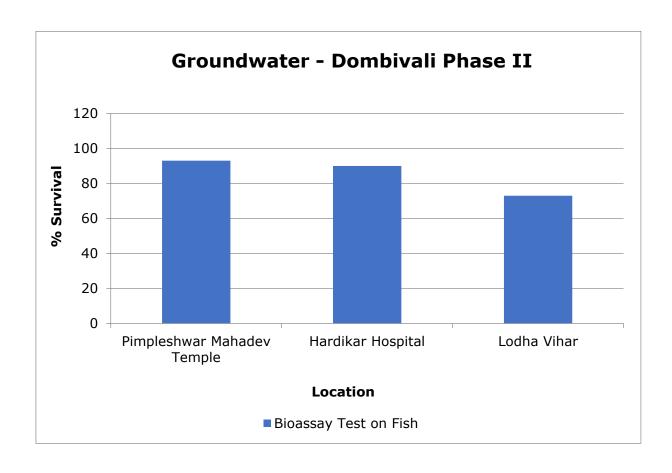

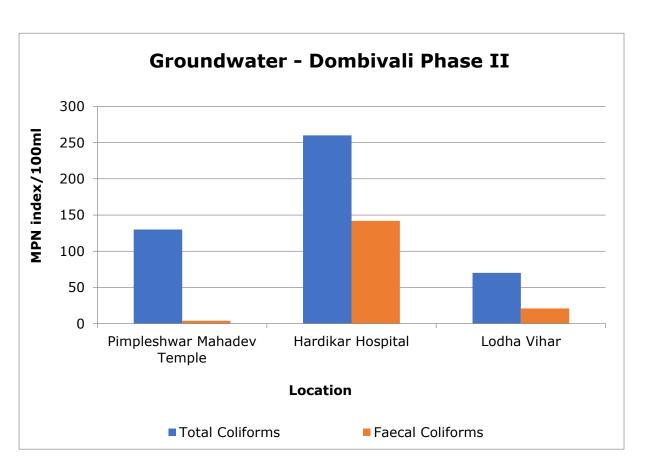

8. Health Related Data

C: Receptor

Com	ponent C
(Impact on	Human Health)
Ма	nin - 10
% increase in cases	Marks
<5%	0
5-10%	5
>10%	10

- % increase is evaluated based on the total no. of cases recorded during two consecutive years.
- For Air Environment, total no. of causes related to Asthma, Bronchitis, Cancer, Acute respiratory infections etc. are to be considered.
- For surface water/ Groundwater Environment, cases related to Gastroenteritis, Diarrhoea, renal (kidney) malfunction, cancer etc are to be considered.
- For the above evaluation, the previous 5 years records of 3-5 major hospitals of the area shall be considered.

Annexure - I Health Related Data enclosed.

9. CEPI Score

Comprehensive Environmental Pollution Index (CEPI) is intended to act as early warning tool which helps in categorization of industrial clusters/ areas in terms of priority of needing attention. The CEPI score have been calculated based on CPCB Letter No. B-29012/ESS (CPA)/2015-16 dated 26th April 2016. The scoring system involves an algorithm that considers the basic selection criteria. It is proposed to develop the CEPI based on Sources of pollution, real time observed values of the pollutants in the ambient air, surface water and Groundwater in & around the industrial cluster and health related statistics.

Table 8.1 CEPI score of the pre-monsoon season 2025 is given below

	A1	A2	Α	В	С	D	CEPI
Air Index	4	4	16	0	10	5	31.00
Water Index	2.5	4	10	17.75	10	5	42.80
Land Index	1.5	4	6	9.75	10	5	30.80
					Aggrega	ated CEPI	48.30

Table 8.2 Comparison of CEPI Scores

	Air Index	Water Index	Land Index	CEPI
CEPI score June 2025	31.00	42.80	30.80	48.30
CEPI score March 2025	35.00	37.00	33.80	44.50
CEPI score June 2024	29.00	46.50	51.00	57.60
CEPI score March 2024	38.50	40.30	32.50	47.80
CEPI score June 2023	28.30	54.80	30.00	58.60
CEPI Score March 2023	34.30	57.50	45.00	64.10
CEPI score June 2021	21.00	56.00	45.00	60.20
CEPI Score March 2021	21.00	59.80	48.00	63.90
CEPI score March 2020	57.30	49.00	29.30	63.40
CEPI score June 2019	44.10	38.50	42.30	53.20
CEPI score March 2019	45 90 41		40.90	55.09

	Air Index	Water Index	Land Index	CEPI
CEPI score June 2018	46.31	40.60	46.20	46.20
CEPI score March 2018	54.88	48.63	46.04	64.98
CPCB CEPI score March 2018	62.00	63.50	27.25	69.67

CEPI Score Calculation:

Dombivali, Maharashtra - CEPI - JUNE 2025

Ambient Air Analysis report

Polluta nt	Grou p	A1	A2	A (A1 V		
Benzene	С	3		(A1 X A2)		
PM2.5	В	0.5	Large			
PM ₁₀	В	0.5				
		4	4	16		

Polluta nt	Avg (1)	Std (2)	EF (3) [(3)=(1) /(2)]	No. of samples Exceedi ng (4)	Total no. of sample s (5)	SNLF Value (6) [(6)=(4)/(5)x(3)]	SNLF score	
Benzene	1.97	2	0.99	0	8	0.00	L	0
PM2.5	11.79	5	2.36	0	8	0.00	L	0
PM ₁₀	41.79	100	0.42	0	8	0.00	L	0
B score = (B1+B2+B3)							В	0

С	10	>10 %
D	5	A-IA-A

Air CEPI	(A+B+C+D)	31.0
----------	-----------	------

Water Quality Analysis report

Polluta nt	Grou p	A1	A2	A (A1 V		
BOD	В	2		(A1 X A2)		
TN	Α	0.25	Large			
TKN	Α	0.25				
		2.5	4	10		

Polluta nt	Avg (1)	Std (2)	EF (3) [(3)=(1) /(2)]	No. of samples Exceedi ng (4)	Total no. of sample s (5)	SNLF Value (6) [(6)=(4)/(5)x(3)]	SNLF score (B)	
BOD	11.53	8	1.44	4	12	0.48	М	15
TN	2.48	15	0.17	0	12	0.00	L	0
TKN	1.15	3	0.38	1	12	0.03	М	2.75
B score = (B1+B2+B3)							В	17.7 5

С	10	>10 %
D	5	A-IA-A

Water CEPI	(A+B+C+D)	42.8
	` ,	

Ground Water Quality Analysis report

Polluta nt	Grou p	A1	A2	A (A1 V		
F	Α	1		(A1 X A2)		
TKN	Α	0.25	Large			
TDS	Α	0.25				
		1.5	4	6		

Polluta nt	Avg (1)	Std (2)	EF (3) [(3)=(1) /(2)]	No. of samples Exceedi ng (4)	Total no. of sample s (5)	SNLF Value (6) [(6)=(4)/(5)x(3)]	SNLF score (B)	
F	1.26	1.5	0.84	1	6	0.14	М	9.75
TKN	1.44	3	0.48	0	6	0.00	L	0
TDS	81.17	2000	0.04	0	6	0.00	L	0
B score = (B1+B2+B3)							В	9.75

С	10	>10 %
D	5	A-IA-A

Water CEPI Score (im) 42.8

Air CEPI score (i2) 31.0

Land CEPI Score (i3) 30.8

 $im + \{(100-im)*i2/100)*i3/100)\}$

Aggregated CEPI Score = where, im = maximum sub-index; and i2 and i3 are

sub-indices for other media

CEPI Score <u>48.30</u>

10. Conclusion

Ambient Air Quality

- The AAQ stations were identified in the CEPI impact area to cover both upwind and cross wind directions and AAQ survey was conducted.
- All parameters are well within the limits as per NAAQS.
- In the CEPI score calculated for Air Environment (35.00) by CPCB in March 2018, PM₁₀ and PM_{2.5} have exceeded which may also be due to the vehicular emissions.
- In the present study, air index is calculated as 31.00

Surface Water Quality

- Higher concentration of BOD and Total Kjeldhal Nitrogen (TKN) was observed in the surface water samples collected which may be due to an increase in microbial activity, leaking septic systems or discharges from sewage treatment plants.
- All the industries in the Dombivali region are either reusing the treated trade effluent as sewage in their process or gardening or are disposed into Sea.
- The Environmental Pollution Index for water is observed as 42.8

Groundwater Quality

- Groundwater samples were collected from different Bore well in the region.
- In the CEPI score calculated for Land Environment by CPCB in March 2018, BOD and Total Ammonia Nitrogen have exceeded in all the samples collected and hence the score was observed as 33.80
- In the present study, environmental pollution index of land is 30.80

CEPI Score

- The CEPI Score pre-monsoon season is 48.30.
- Collective efforts of MPCB, administration and environmental organizations have resulted in improved and safer groundwater. This shows a decline in pollution levels in Dombivali.
- The present study is the compilation of pre-monsoon season, which results in dilution of environmental samples resulting in lower pollution load, hence also affecting the total score.
- In conclusion, a decrease of approx. 31% in CEPI score is observed from 69.67 of the CPCB score of March 2018 to 48.30 in June 2025.

11. Efforts Taken by MPCB to Control and Reduce Environmental Pollution Index

- Drive against open burning of biomass, crop residue, garbage, leaves, etc.
- Organic Waste Compost machines: Residential complexes or Commercial complexes more than 20,000 sqm BUA has installed organic waste compost machines individually.
- Waste collection and segregation centres: KDMC has provided waste collection segregation centres at various places and also segregation is carried out at MSW processing sites.
- Construction of Common Effluent Treatment plant (CETP): Two CETPs are in operation. 1. CETP having capacity 16 MLD for textile effluent 2, CETP having capacity 1.5 MLD for chemical effluent.
- Installation of CEMS installed for Air and Water in Large and Medium scale RED category industries: Online monitoring system with SCADA and NRV system provided by the industries.
- Arrangement of scientific collection and treatment of sewage generated: KDMC has provided 9 STPs, out of which 6 STPs are in operation. Rest will be brought into operation, so as to cater the entire 216 MLD domestic effluent.
- Installation of CAAQMS station: Two stations
- Number of CAAQMS proposed for future: Two stations are installed one is at Pimpleshwar Temple, MIDC Dombivali, Phase-II and second at 'B' Ward KDMC, Kalyan (W).
- Two Monitoring stations under the National Water Quality Monitoring Programme (NWMP) are established.
- Steps are taken for industrial areas/other units to recycle 100% treated effluent to achieve zero liquid discharge (ZLD)- Forty units have achieved Zero Liquid Discharge.
- Steps taken to reduce dust emission: -
 - 1. Board has changed the norms of TPM from 150 mg/Nm³ to 50 mg/Nm³ in consent.
 - 2. Board is promoting the use of PNG as fuel to the boiler.
 - 3 Concreted road with tree plantation along the road is going on
- Tree plantation: 6000 nos.
- Other initiatives taken to control and reduce pollution in air, surface water and groundwater:
 - a) To know the status of air quality in Kalyan Dombivali area MPC Board has installed two CAAQM stations and two AAQM stations. Out of which two are installed in MIDC area and other two are installed other than MIDC area.
 - b) The MPC Board is continuously in touch with industry to use the proper quantity of fuel to the boiler to avoid the overload and thereby emission. As well as ensure that air pollution control system provided by industry are continuously operation are not
 - c) Night monitoring was also carried out to check the status during the night period.
 - d) Industries located in the MIDC area are discharging partially treated effluent to CETP through underground pipelines. No direct discharge of effluent to the nallah by the industries.
- Introduction of Deep Clean Drive Campaign, wherein Daily Targeted Roads are Washed & Cleaned using Non-Potable Water.

- In F.Y 2023-24, from Last Winter i.e., Start of Nov 2023 to till date, approx. 1,04,493.938 Kms. of road length is washed with the help of more than 5000 Tankers.
- For Suppression of road dust Sprinkling Machines & Misting Machines are deployed.
- Under Deep Clean Drive Campaign, more than 2250 MT of garbage & more than 875 MT of odd trash/abandoned materials were removed.
- Deployment of 114 E-buses, 67 old diesel buses [more than 10 years] are phased out from fleet & monthly average 35,500 litres of diesel is saved resulting in reduced carbon emissions.





Deployment of E-buses, and charging stations



PNG Crematorium



C&D Plant - 300 TPD



Stationary Water Cannons





Ambient Air Quality Monitoring (AAQM) Van



Continuous Ambient Air Quality Monitoring Station (CAAQMS)

12. Photographs

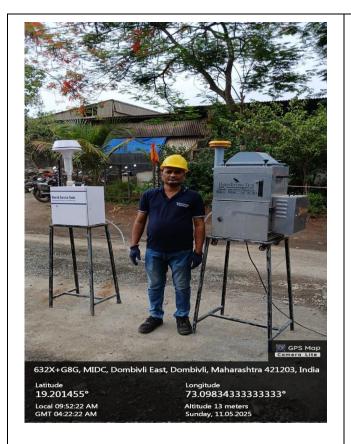

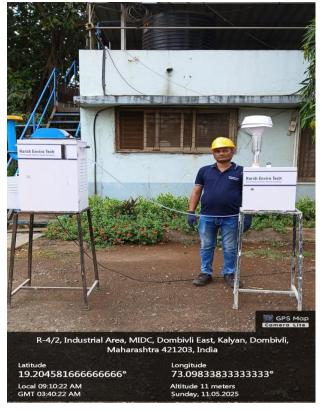

Ambient Air Sampling MIDC, Dombivali East, Dombivali



Ambient Air Sampling 53VW+Q7M, Pimpleshwar Mandir Rd, Sagaon Dombivali

Ambient Air Sampling R-4/2, Industrial Area, Kalyan Dombivali



Ambient Air Sampling Phase 1, MIDC Industrial Area, Kalyan Dombivali





Surface Water Sampling, Star Colony, Gandhi Nagar, Dombivali East, Dombivali


Surface Water Sampling Kanchangaon, Dombivali East, Dombivali





Surface Water Sampling Dombivali East, Dombivali

Surface Water Sampling Indo Amines Ltd, Kalyan Dombivali

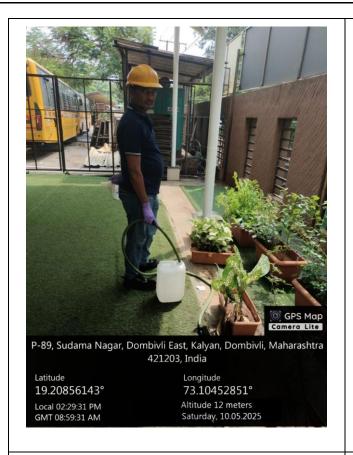



Ground Water Sampling, Sudama Nagar, Dombivali



Ground Water Sampling Bhadra Nagar, Dombivali East, Dombivali

Ground Water Sampling Sagaon, Dombivali



Ground Water Sampling Shani Mandir, Dombivali

Annexure - I Health Related Data

HEALTH STATISTICS

Required for Comprehensive Environmental Pollution Index (CEPI)

Maharashtra Pollution Control Board (MPCB), MAHARASHTRA

Name of the Polluted Industrial Area (PIA)	DOMBIVALI
Name of the major health center/ organization	Mamta Hospital
Name and designation of the Contact person	und Head.
Address	

S No. Diseases		No. of Patients Reported	
	Diseases	Year 2023	Year 2024
RBORN	NE DISEASES		
1.	Asthma	A7	67
2.	Acute Respiratory Infection	189	210
3.	Bronchitis	140	160
4.	Cancer	15	21
ATERB	ORNE DISEASES		
1.	Gastroenteritis	119	138
2.	Diarrhea	80	138
3.	Renal diśeases	50	60
4.	Cancer	15	21

Date:

HEALTH STATISTICS

Required for Comprehensive Environmental Pollution Index (CEPI)

Maharashtra Pollution Control Board (MPCB), MAHARASHTRA

	The second secon	
Name of the Polluted Industrial Area (PIA)	DOMBIVALI	
Name of the major health center/ organization	Municipal Hospital	
Name and designation of the Contact person		
Address		

			Patients Reported
S No. Diseases	Diseases	Jan 2023 of Deca	7073. 2024 000
AIRBOR	NE DISEASES		
1.	Asthma	04	05
2.	Acute Respiratory Infection	12	20
3.	Bronchitis	01	01
4.	Cancer	Ni).	02
VATERBO	DRNE DISEASES		
1.	Gastroenteritis	24	63
2.	Diarrhea	52	131
3.	Renal diseases	01	02
4.	Cancer	01	02

Date: 10/2/2025

Signature

HEALTH STATISTICS

Required for Comprehensive Environmental Pollution Index (CEPI)

Maharashtra Pollution Control Board (MPCB), MAHARASHTRA

Name of the Polluted Industrial Area (PIA)	DOMBIVALI
Name of the major health center/ organization	Hambarde Hospital
Name and designation of the Contact	Tai Pinje Chowk OPP SOTVES
Address	Hall Dorn (E)

S No. Diseases		No. of Patients Reported	
	Diseases	Year 2023	Year 2024
IRBOR	NE DISEASES		
1.	Asthma	22	18
2.	Acute Respiratory Infection	4	5
3.	Bronchitis	4	4
4.	Cancer	G	4
WATER	BORNE DISEASES		
1.	Gastroenteritis	-23	25
2.	Diarrhea	23	26
3.	Renal diseases	17	10
4.	Cancer	6	4

Date:

Signature 1 Dr. Rajiv K. Hambarde (M.: .. Reg.No. 53659 Consulting General & Laperoscopic Surgeon HAMBARDE HOSPITAL

Pag.No. KMC / HD / BNHR / 02 / 019 / 9445